

NUMBER OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
TRANSPORTER	OIL
	GAS
PRORATION OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

FORM C-103
(Rev 3-55)

MISCELLANEOUS REPORTS ON WELLS

(Submit to appropriate District Office as per Commission Rule 1106)


Name of Company Mountain States Natural Gas Corp.				Address 406 Petroleum Plaza, Farmington, N.M.			
Lease Kilgore	Well No. 1	Unit Letter G F	Section 36	Township 25N	Range 2W		
Date Work Performed 1-18-63	Pool Gavilan PG			County Rio Arriba			

THIS IS A REPORT OF: (Check appropriate block)

- ☐ Beginning Drilling Operations
 ☐ Casing Test and Cement Job
 ☐ Other (Explain):
☐ Plugging
 ☒ Remedial Work

Detailed account of work done, nature and quantity of materials used, and results obtained.

Drilled out casing shoe at 3510' and cleaned out below casing to 3555'. Perforated 5 1/2" casing from 3478-80 with 8 holes. Sand-water fraced Pictured Cliffs with 30,000 gals/ water and 35,000 # sand. Swabbed well in.

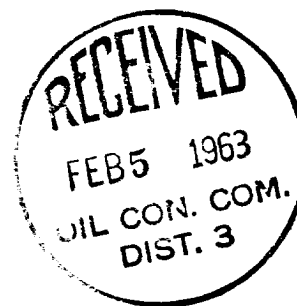

Witnessed by	Position	Company
--------------	----------	---------

FILL IN BELOW FOR REMEDIAL WORK REPORTS ONLY

ORIGINAL WELL DATA

D F Elev. NA	T D 3612	P B T D 3555	Producing Interval 3478-3555	Completion Date 1-18-63
Tubing Diameter 1 1/2	Tubing Depth 3500	Oil String Diameter 5 1/2	Oil String Depth 3510	

Perforated Interval(s) Pictured Cliffs 3478-80	Producing Formation(s) Pictured Cliffs 3510-55
--	--

RESULTS OF WORKOVER						
Test	Date of Test	Oil Production BPD	Gas Production MCFPD	Water Production BPD	GOR Cubic feet/Bbl	Gas Well Potential MCFPD
Before Workover						
After Workover	No Production 1-29-63		1400	none		1400

OIL CONSERVATION COMMISSION		I hereby certify that the information given above is true and complete to the best of my knowledge.	
Approved by Original Signed by W. B. Smith	Name [Signature]		
Title DEPUTY OIL & GAS INSPECTOR DIST. NO. 3	Position Vice-Pres.		
Date FEB 5 1963	Company Mountain States Natural Gas Corp.		