

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office San Antonio

Lease No. 1 07709

Unit 1/4, Sec. 2, T.25N,
R.3E, Rio Arriba Co. N.M.,
New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 13, 1941

Well No. 2-1 is located 220 ft. from N line and 125 ft. from E line of sec. 2

33A, Sec. 2 (1/4 Sec. and Sec. No.) 25N (Twp.) 3E (Range) N.M. (Meridian)


San Antonio (City or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 7225 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1. Spudded 12" surface hole at 7:00 A.M. 8/16/41. Drilled to T.D. of 230' A.M.
2. Ran 6 joints, 8-5/8", 31.00, J-25 surface casing on 8/16/41. Landed at 225' A.M. Cemented with 125 sacks regular with 2% Ca Cl₂. Plug down 2:00 P.M. 8/16/41.
3. Hoisted up. Pressure up on surface casing to 300 psi for 10 minutes on 8/17/41. Pressure held.

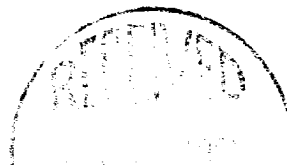

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company AMERICAN OIL & REFINING CO.

Address San Antonio

San Antonio, New Mexico

By Gilbert D. Roland

Gilbert D. Roland, Jr.

Title Drilling Superintendent