

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSUBMIT IN TRIPPLICATE\*  
(Other instructions on re-  
verse side)Form approved.  
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 078884

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

## SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	7. UNIT AGREEMENT NAME Canyon Largo Unit
2. NAME OF OPERATOR El Paso Natural Gas Company	8. FARM OR LEASE NAME Canyon Largo Unit
3. ADDRESS OF OPERATOR Po Box 990, Farmington, NM 87401	9. WELL NO. 93 (P&A)
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 990'N, 990'E	10. FIELD AND POOL, OR WILDCAT So. Blanco P. C.
14. PERMIT NO.	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 12, T-25-N, R-6-W NMPM
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6702'GL	12. COUNTY OR PARISH Rio Arriba
	13. STATE New Mexico

## 16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

## NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON\*

CHANGE PLANS

## SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT\*

(NOTE: Report results of multiple completion on Well  
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

This well has been plugged and abandoned in the following manner:


Spotted a 25 sk. cement plug to cover perforations (2820-2844'.)

Cut 2 7/8" pipe at 232, could not pull pipe, spotted a 25 sk. plug over cut at 232'.

Backed off 2 7/8" pipe at 120' and spotted a 15 sk. cement plug at base of surface pipe at 106'.

Placed a 10 sk. cement plug at the surface with a 4' x 4" Plug and Abandonment marker.

10-26-71 - Date plug &amp; abandonment was completed.

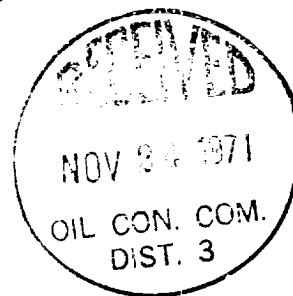

18. I hereby certify that the foregoing is true and correct

SIGNED

Original Signed F. H. WOOD

TITLE Petroleum Engineer

DATE November 16, 1971

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side