


X			

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. C1517
Unit Canyon Largo

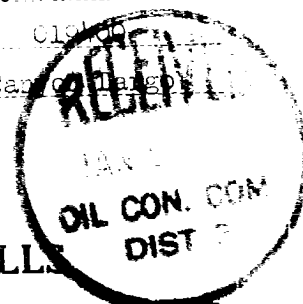

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	X
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

STANOLIND-SKELLY-GOVERNMENT #1-4: January 18, 1957

Well No. 1-4 is located 290 ft. from N line and 290 ft. from E line of sec. 4

1/4 Section 25N 6W 12W
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
MC (Canyon Largo) Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6243' ^{KB}/ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-16-57 PERFORATED: 2356-2368 w/8 Bullets/ft.

1-17-57 SAND-WATER FRAC'D PERFS: Mixed 30,000# sand w/25,000 gals. water and flushed w/6000 gals water. Max pressure 2250#, min pressure 1650#. FP 1200#. Injection rate 42.8 BPM. Job complete @10:30 AM.

1-17-57 Swabbing & cleaning out after Frac Job.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company The Superior Oil Company

Address Midland, Texas

By W. J. Mathis (W. J. Mathis)

Title Petroleum Engineer



1940
200

1940

200

1940

200

1940

200

1940

200

1940

200

1940

200

1940

200