


(SUBMIT IN TRIPLICATE)

Indian Agency _____

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee **Mearilla**

Lease No. **Contract #136**

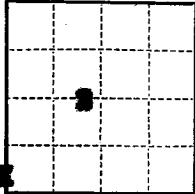

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL _____	SUBSEQUENT REPORT OF WATER SHUT-OFF _____	
NOTICE OF INTENTION TO CHANGE PLANS _____	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING _____	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF _____	SUBSEQUENT REPORT OF ALTERING CASING _____	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL _____	SUBSEQUENT REPORT OF REDRILLING OR REPAIR _____	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE _____	SUBSEQUENT REPORT OF ABANDONMENT _____	
NOTICE OF INTENTION TO PULL OR ALTER CASING _____	SUPPLEMENTARY WELL HISTORY _____	X
NOTICE OF INTENTION TO ABANDON WELL _____		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

August 17, 19 59

Well No: **5-16-2** is located **200** ft. from **S** line and **200** ft. from **W** line of sec. **2**

2 **24N** **4W** **10W**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Designated (22-211) **El Arriba** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

The elevation of the ~~surface~~ **top of ground** above sea level is **6520** ft.



DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

7200 TD
DOT 25 from **7200-7415**. **SI 20** mins, open **4** hrs, **SI 1-1/4** hrs. Fair blow of air dear to weak blow after **20** mins. **2200** **2700**; **27 45**, **277 00**, **278 20**, **279 00**. Recovered **100'** of drig mud. **DOT 25** from **7170-7200**. Packer failed. Run **20** jts **7" 200 2-00**, **45** jts **200 3-00**, **100** jts **200 3-00** and **21** jts **200 3-00** with **2V** stage tool at **2100'**. **217000'** set at **7201**. Cased lat stage with **100** and **20-00** Peanix. **200 5:15** **21 2-15-00**. Cased 2nd stage with **100** oz reg. Tested cog with **2500** psi. **OK**. Drig out **2V** tool & retested with **1500** psi for **20** mins. **OK**

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **ROCKWELL PROPERTIES CORPORATION**

Address **200 Stone Building**
Albuquerque, N. M.

By **M. B. JONES**
M. B. Jones
Title **Asst. Eng., Prod. Oper.**

100