

(SUBMIT IN TRIPLICATE)


Land Office Santa Fe

Lease No. SP-079712-0

Unit _____

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Co. Lee. No. 239549

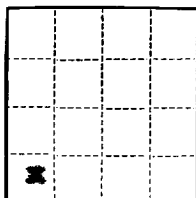

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

TANNER UNIT

Farmington, New Mexico December 26, 1957

Well No. 1 is located 1010 ft. from (N) line and 970 ft. from (E) line of sec. 21

SW/4 Section 21
(1/4 Sec. and Sec. No.)

T-24-N
(Twp.)

R-12-W
(Range)

(Meridian)

Tanner Unit
(Field)

San Juan
(County or Subdivision)

New Mexico
(State or Territory)


The elevation of the derrick floor above sea level is 6087 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Verbal approval received 12-12-57.

- 12-18-57: Opened well, flowed 1/2 bbl load oil. Ran sand pump & checked bottom. Ran 2863' - 2" tbg. set at 2874' w/Sweet packer at 2808'. Well flowed over on each joint run. Stubbed tubing down & started swabbing 100% fresh water.
- 12-20-57: Ran Baker CI cement retainer set at 2860'. Reversed oil out of hole. Squeezed perf. from 2870' - 2878' w/75 ex reg cement at 2800'. Dumped 8/10 bbl. cement on top of retainer.
- 12-21-57: Removed BOP & "B" section of wellhead.
- 12-24-57: Set top plug w/15 sacks cement. Plugged & abandoned and well markers installed.

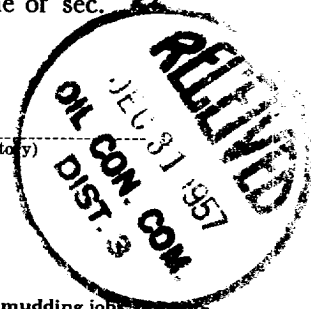

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Humble Oil & Refining Company

Address Box 1268

Farmington, New Mexico

By COPY SENT R. M. LILLY
Russell M. Lilly

Title Agent