

1-1000
1-10000
1-100 00
1-1000
1-1000

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 42-R358.4
Approval expires 12-31-60.

Land Office Santa Fe
Lease No. 079056
Unit _____

RECEIVED

MAR 13 1958

SUNDRY NOTICES AND REPORTS ON WELLS
GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	Free

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 14, 1958

Federal

Well No. 2-9 is located 640 ft. from N line and 640 ft. from E line of sec. 9

NE 1/4 Sec 9 24N 10W 106N

(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)

Dist. 1st San Juan New Mexico

(Field) (County or Subdivision) (State or Territory)


The elevation of the ground level derrick floor above sea level is 6900 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Perf w/2 1/2 combination & shots per foot from 1350-40, 5292-5310, 5310-Perfo w/26,000 gal crude, 26,000/ 20-40 Ottawa sd. Breakdown 3000/ initial free 2200/, Average Free 26,000/, Maximum Free 3000/, final free 2600/, Average Inj rate 26 bbls/min. Job complete 3-12-58.

ILLEGIBLE

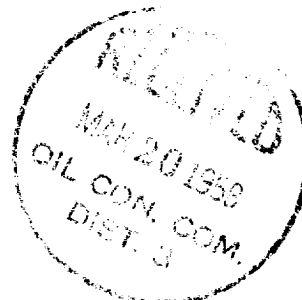

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Val R. Reese & Assoc., Inc.

Address 120 S. Commercial

Farmington, New Mexico

By _____

Title Consulting Engineer