

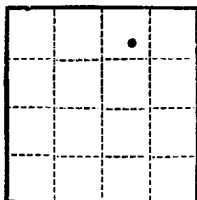
Federal 7-7 #5

Budget Bureau No. 42-R3394  
Approval expires 12-31-61

(SUBMIT IN TRIPLICATE)

Land Office Santa FeLease No. 078302-A

Unit \_\_\_\_\_

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEYSec. 7  
**SUNDRY NOTICES AND REPORTS ON WELLS**

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	X
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Oct 1, 1959, 19

Federal 7-7

Well No. 5 is located 660 ft. from {N} line and 1930 ft. from {E} line of sec. 7NW/4 NE/4 Sec. 7 24N 9W N12W  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)Dist. Lower Gallup San Juan County New Mexico  
(Field) (County or Subdivision) (State and Territory)The elevation of the derrick floor above sea level is 6825 ft.

## DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

The well was spudded at 10:30 PM 9-8-59. The 8-5/8" csg was set at 339' and cemented to surface with 200sks neat cement. After WOC 24 hrs., the pipe was tested ~~with~~ okay with 1000psi. A 7-7/8" hole was then drilled to a TD of 5577'. 5 1/2" csg was set at this point and cemented with 300sks neat cement. After WOC 30 hrs., the pipe was tested okay w/1500psi. The interval 5450-5466 was perforated with 4 jets per ft. The well was fraced down casing with 15,000 gal oil and 30,000# sand. Avg injection rate was 38BPM at 2000 psi. 500 gal mud acid was spotted ahead of the frac. Presently the well is being cleaned out.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Standard Oil Company of TexasAddress Box 1581Farmington New MexicoBy CW LantryTitle Field Foreman

1. The first part of the document is a list of the names of the persons who have been appointed to the various offices of the Board of Directors of the Corporation.

2. The second part of the document is a list of the names of the persons who have been appointed to the various offices of the Board of Directors of the Corporation.

3. The third part of the document is a list of the names of the persons who have been appointed to the various offices of the Board of Directors of the Corporation.

4. The fourth part of the document is a list of the names of the persons who have been appointed to the various offices of the Board of Directors of the Corporation.

5. The fifth part of the document is a list of the names of the persons who have been appointed to the various offices of the Board of Directors of the Corporation.