


(SUBMIT IN TRIPLICATE)

Land Office 57

Lease No. 086136

Unit \_\_\_\_\_

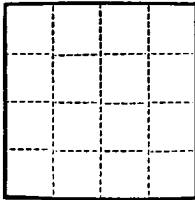

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

Well No. 1-27 is located 2050 ft. from N line and 200 ft. from E line of sec. 27  
27 (1/4 Sec. and Sec. No.) 25N 6E 100W  
 (Twp.) (Range) (Meridian)  
33 (Field) 310 (County or Subdivision) OK (State or Territory)

The elevation of the derrick floor above sea level is 5772 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Proposed operations from 3506 to 3620 with 2 1/2" ex of regular cement. Drilled out cement and tested to 350 lbs. Aquo Rod series from 7162 to 7167 with 100 ex regular and 75 ex of 1 1/2" ex cement. Set cement plug at 7163. Perforated from 7171 to 13, fr 7166 to 13 and fr 7161 to 7164 with 4 shots of 1/2". Well was fractured with 60, 200 gal water and 3, 700 lbs. acid. Well was run in, and now flowing to stream here to clean up. Shut in for potential test to see if fine water is recovered.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Oil Control

Address 7034 Central Ave

Lawrence, N. M.

By Jay G. Harris

Title Geologist

