

(SUBMIT IN TRIPLICATE)


UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 45-1000-6
Approval expires 12-31-52

Indian Agency _____

Allottee Shawnee

Lease No. _____

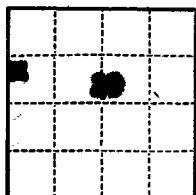

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	MAR 14 1958 U. S. GEOLOGICAL SURVEY FARMINGTON, NEW MEXICO
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 13, 1958

Well No. 12-20 is located 1200 ft. from N line and 700 ft. from W line of sec. 20

24 24 20 200 40 1000
(34 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
De Simms San Antonio New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the 1200 above sea level is 7000 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drill 4" hole to 1200'. Started out of hole and stuck 20' of 2 1/2" pipe. Struck to free pipe w/ell. Run string and backed off drill string leaving 3 drill collars, sub and bit in hole. Struck to free stick by jarring. Set plug w/20' on top and 3 on each. Job camp 4 on 1-12-58. After 10 hrs run, found top of plug at 975'. Cement drill collar. Spotted last plug of 20 on top and 3 on each at 1200'. Struck out plug to 975' and cut whipstock. Drilled off whipstock w/4" bit to 1200'. Struck out of hole and stuck drill pipe at 975'. Struck to free pipe w/ell at 1200' hole with. Backed off leaving 4 - 4-5/8" drill collars and 4" bit in hole. Struck over 20' and stick dropped to 1200'. Struck to recover back into stick. Run to P & A.

I understand that this plan of work must receive approval in writing by the Geological Survey before operation.

Company _____

Address _____

NORTHWEST PRODUCTION CORPORATION
520 Simms Building
Albuquerque, New Mexico

By RAY PHILLIPS
Ray Phillips

Title Asst. Eng. Sand Gr.

