

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**
Lease No. **NM 03733**
Unit **Bresch**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	X
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

1-14-, 1959

Well No. **FMD-224** is located **865** ft. from **[N]** line and **1140** ft. from **[E]** line of sec. **13**

NE 1/4 NE 1/4 Section on **13** **26N** **7W** **NMPM**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
South Blanco **Rio Arriba** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **6463** ^{KB} ft. ~~6490-6492~~


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

1-8-59 Drilled to TD 3000'.

Cemented 2997' 9 5/8" OD 40# J-55 Short T&C Casing with Centralizers at 2806 and 2714 used 7 scratchers spaced 15' apart. Cemented casing with 250 sacks 4% aquagel and 50 sacks neat cement.

Plug down 9:30 AM 1-9-59

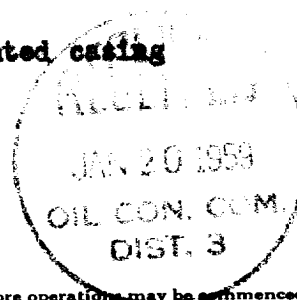

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Caulkins Oil Company**

Address **P. O. Box 967**

Farmington, New Mexico

By *[Signature]*

Title **Prod. Foreman**