


(SUBMIT IN TRIPPLICATE)

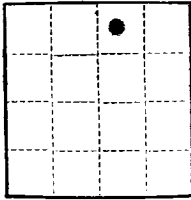

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 077033 A
Unit Artesian

SUNDRY NOTICES AND REPORTS ON WELLS RECEIVED

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	JUL 29 1958
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Supplement report of fracturing</u>	I

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 28, 1958

Well No. PC 127 is located 990 ft. from N line and 1650 ft. from E line of sec. 8

5 264 6 N74E
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
South Platte Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6477 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Fractured with 42,000# sand and 35,196 gallons water, 4-28-58.

Breakdown pressure 1600 to 1200#
Treating pressure 1625 to 1600#
Final pressure 600#
Average injection rate 47.8 BPM

Deliverability before treatment 91 Mcf
Deliverability after treatment 832 Mcf



I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Caulkins Oil Company

Address Post Office Box 967

Farmington, New Mexico

By Frank Gray
Title Field Superintendent