

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER		5. LEASE DESIGNATION AND SERIAL NO. Jicarilla 101	
2. NAME OF OPERATOR Southland Royalty Company		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR P. O. Drawer 570, Farmington, New Mexico 87401		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1820' FSL & 1135' FEL		8. FARM OR LEASE NAME Jicarilla 101	
14. PERMIT NO.		9. WELL NO. #1-A	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 7139' GR		10. FIELD AND POOL, OR WILDCAT Basin Dakota Blanco Mesa Verde	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec. 1, T26N, R4W	
		12. COUNTY OR PARISH Rio Arriba	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

Casing Report


(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 10-3-78 Ran 98 joints of 7 5/8", 26.40#, N-80 casing and landed at 4190'. Cemented with 360 sacks of Class "B", 50/50 poz with 6% gel and .6% Halad 9, followed by 70 sacks of Class "B" with 2% CaCl₂ with .6% Halad 9. Plug down at 7:30 AM, 10-4-78.
- 10-8-78 Ran 113 joints of 5 1/2", 17.0 & 15.50#, K-55, 8 rd casing set from 4039' to 8304'. Cemented with 410 sacks of 50/50, poz with 6% gel, 1/4# gel flake per sack, 0.5% CFR-2 and 0.4% HR-7. Plug down at 6:40 PM, 10-8-78.

18. I hereby certify that the foregoing is true and correct

SIGNED

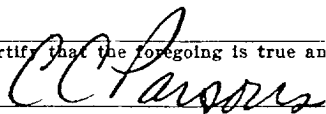

TITLE District Engineer

DATE 10-9-78

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

RECEIVED
DATE

OCT 10 1978

kde

*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY
DURANGO, COLO.