

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well ☐ gas well ☒ other

2. NAME OF OPERATOR

Tenneco Oil Company

3. ADDRESS OF OPERATOR

Box 3249, Englewood, CO 80155

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 940' FNL, 1000' FWL

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:


16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) ☐


SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐

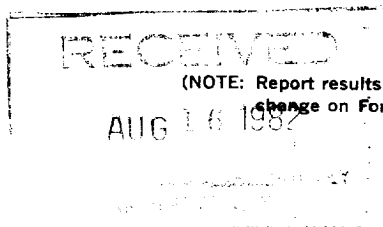

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

8/3/82: MIRURT, spud well @ 11:15 am, 8/3/82 W/4 Corners Rig #8. Drill 12 1/4" hole, C&C, POOH. RU & run 7 jts (295') 9-5/8" 36# K-55 ST&C csg set @ 306'. RU & cmt w/225 sx Cl-B & 2% CaCl₂ + 1/4#/sx flocele. PD @ 6:15 pm 8/3/82. WOC. Circ cmt. to surface. NUBOP, test stack to 1,000 psi for 24 hrs ok. Test pipe rams, ok.

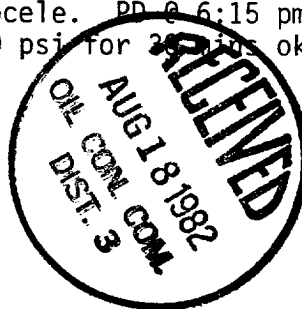

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Denise Wilson TITLE Production Analyst DATE August 13, 1982

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____

ACCEPTED FOR RECORD

AUG 17 1982

BY [Signature]
FARMINGTON DISTRICT

*See Instructions on Reverse Side

NMOCC