

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 679265  
Unit Kelly Klein

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Water Frac.</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 5, 1960


Well No. 8 is located 1090 ft. from N line and 1150 ft. from E line of sec. 34  
NE/4 Sec. 34 26N 6W S.M.P.M.  
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
So. Blanco Pictured Cliffs Rio Arriba New Mexico  
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6342 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

December 10, 1959 Total Depth 2654'. C.O.T.D. 2630'. Water fractured Pictured Cliffs perf. int. 2548-54; 2570-80; 2586-94; 2614-22 (2 DS/Ft.) w/34,300 gallons water and 35,000# sand. SD pr. 1000#, max. pr. 1350#, avg. tr. gr. 950-1000-1100-1175-1200#. I.R. 31 MM. Flush 3600 gallons. Dumped 250 gallons BDA ahead of treatment. All water contained 1% Calcium Chloride. Injected 4 sets/12 balls.

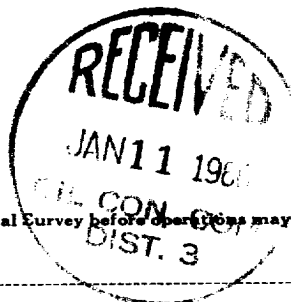

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 991  
Farmington, New Mexico

By ORIGINAL SIGNED A.M. SMITH  
Title Petroleum Engineer