

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. SP 07964
Unit J. C. Daum

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<u>Production</u>	<u>X</u>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING		
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING		
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR		
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT		
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY		
NOTICE OF INTENTION TO ABANDON WELL	<u>Report of Drill Stem Test No. 1</u>		<u>X</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 8, 1957

J. C. Daum
Well No. 1 is located 1650 ft. from S line and 990 ft. from E line of sec. 26
SE/4 Section 26 25N 11W N.M.F.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Undesignated (Callup) San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is _____ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)


Ran 164 Jnts. 5 1/2" casing set at 5163' and cemented with 125 sacks pozzix and 125 sacks regular cement.

DRILL STEM TEST NO. 1 4920-4995'.

Tool open 2 hrs. with weak blow of air throughout. Pulled drill pipe and recovered 180' slightly gas-cut mud. Hyd. pressure in 2475#, out 2470#. IFP 100#, FFP 120#, 30 min. SIBHP 180#.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company SKELLY OIL COMPANY
Box 426
Address Farmington, New Mexico

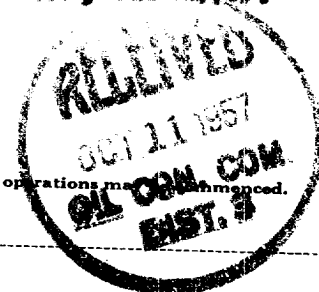

By (Signed) E. E. Cooper

Title District Superintendent