

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well

2. NAME OF OPERATOR

M. J. Brannon, Jr.

3. ADDRESS OF OPERATOR

3417 Hulen St., Suite 124, Ft. Worth, Tex. 76107

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE:

AT TOP PROD. INTERVAL: Approximately 4400'

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) ☐

SUBSEQUENT REPORT OF:

☐

☐

☐

☒

☐

☐

☐

☐

☐

5. LEASE

Federal - SF078530

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

M. J. Brannon, Jr. Federal 20

9. WELL NO.

20-1

10. FIELD OR WILDCAT NAME

Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

P 20-25N-9W

12. COUNTY OR PARISH

San Juan

13. STATE


New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

6648 GL

(NOTE: Report results of multiple completion or change on Form 9-331-C)

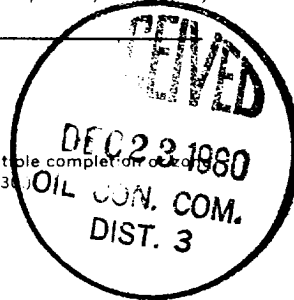

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

11-17-80 MIRU Aztec Well Servicing Rig #204. Unseat Packer. Rig up Dowell pump truck. Try to circulate Kempak out, pump 50 bbl. H₂O @ bpm @ 2200#, 50 bbls. @ 2700#. No results. Shut down for night.

11-18-80 Took to 6147'. Packer stuck, work down to 6180'. Could not back off. Shut down for night.

11-19-80 Hot oil tubing with 20 bbls. H₂O. Tubing free. Back off on top of packer. Took with tubing. Holes in tubing from 4032' to 4530'. Lay down bad tubing. Shut down for night.

11-20-80 TIH with 4-1/2" casing scrapper. Could not get to bottom. TOOH. TIH, wash to bottom. Could not screw into packer. Backed off. TOOH, left 2 jts. tubing, scrapper and safety jt. in hole. Shut down for night.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED

M. J. Brannon, Jr.

TITLE

operator

DATE

12-10-80

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

DEC 22 1980

NMCCC

BY *1*