

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Form Approved.
Budget Bureau No. 42-R1424

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ gas ☒ other ☐
well well

2. NAME OF OPERATOR

M.J. Brannon, Jr.

3. ADDRESS OF OPERATOR

3417 Hulen St., Suite 124, Ft. Worth, Tex. 76107

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE:

AT TOP PROD. INTERVAL: Approximately 4400'

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

CHANGE ZONES ☐

ABANDON* ☐

(other) ☐

SUBSEQUENT REPORT OF:

☐

☐

☐

☒

☐

☐

☐

☐

☐

5. LEASE

Federal - SF078530

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

M. J. Brannon, Jr. Federal 30

9. WELL NO.

20-1 51

10. FIELD OR WILDCAT NAME

Basin Dakota

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

P 20-25N-9W

12. COUNTY OR PARISH 13. STATE

San Juan


New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

6648 GL

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

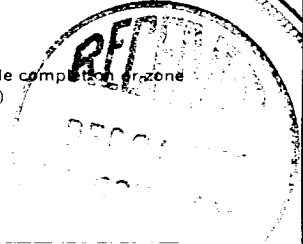

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

11-21-80 Ran NL/McCullough casing inspection log from 5000' to surface. Found holes from 3500' to 4500' with one @ 1600'. TIH with tubing, screw on to fish. TOOH, did not recover packer. Shut down for night.

11-22-80 TIH with packer collar. Had fill up 2' above packer, could not circulate down to screw on packer. Would pressure up when all weight was set down. TOOH. Shut down for night.

11-23-80 Shut down for Sunday.

11-24-80 TIH with taper tap. TOOH with same. Did not catch packer. Shut down for night.

11-25-80 TIH with Baker Model "G" Packer to swab well. Trouble getting past bad casing. Could not set packer. Pulled 1 jt. out. Left packer and 5950' of tubing in hole. NUWH. Released rig.

11-28-80 Roustabout crew fenced pit. Hauled ^{surplus} tubing to yard.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED M. J. Brannon, Jr. TITLE operator DATE 12-11-80

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

Redrill is planned for 1981.
Evaluating to P&A due to inability to produce.