

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Budget Bureau No. 42-R358.4.
Form Approved.

Land Office Santa Fe, N.M.
Lease No. SF-678063
Unit Carson


SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	
Notice of Conversion to Injector <input checked="" type="checkbox"/>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 5, 19 61

Well No. 22-10 is located 1980 ft. from S line and 1080 ft. from W line of sec. 12
SE NW 19 25 N 11 W 100M
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Bisti San Juan New Mexico
 (Field) (County or Subdivision) (State or Territory)

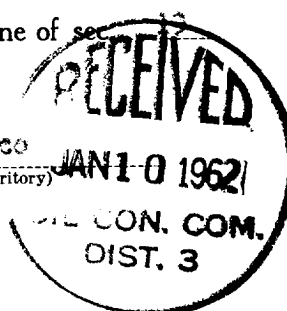

Kelly Bushing

The elevation of the derrick floor above sea level is 6448.9 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

TD 5030, PBD 5027, Casing 3-5/8 x 108, 4-1/2 x 5027, Perfs 4 (1/2" holes/ft.)
 Status: in intervals 4268-28, 4898-4205, 4934-42, 4952-62, 4968-80

Proposed Work:

1. Pressure test tubing with 1000 psi for 15 min.
2. Pull tubing and bail clean.
3. Run 2-3/8" open-ended tubing to bottom and swab while running clean Point Look-out water (treated with Triton X-100 detergent) down casing. When fluid cleans up, pull tubing.
4. Run 2-3/8" tubing with packer ten feet above perforations.
5. Dump 60 bbls. of inhibited water down annulus to displace uninhibited fluid. Set packer and fill with inhibited water.
6. Run pressure and temperature surveys as directed.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company

Address P.O. Box 1200

Farmington, New Mexico

Original Signed By
W. M. MARSHALL

By W. M. Marshall
Title Division Exploitation Engineer