

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe, N. M.**
Lease No. **87 076061**
Unit **14-02-001-3493**

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....	Subsequent report of Completion	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 10, 1957

Carson Unit
Well No. **23-17** is located **1900** ft. from **11E** line and **2065** ft. from **11W** line of sec. **17**
11E 17 (1/4 Sec. and Sec. No.) **25N** (Twp.) **11E** (Range) **106M** (Meridian)
Wilcox (Field) **San Juan** (County or Subdivision) **New Mexico** (State or Territory)

Kelly Bunking
The elevation of the ~~surface~~ above sea level is **6374** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

3-7-57 Ran 152 fts (5036') **5-1/2"**, **14#** casing at **5045'** cemented with **200 sacks** construction cement, (5 bbl water ahead). Pressure tested with **1500 psi**, **O.K.** Displaced and with of **1"** Ran Gamma Ray log, preparing to perforate.
3-8, 9, Perforated four 1/2" jets/ft intervals 4872-4874, 4881-4883, 4888-4896, 10-57 4934-4936, 4949-4953 and 4967-4972. Shotted well into production.


Initial Production

Flowing, **312 b/d** gross, **312 b/d** oil, cut **0.1%**, **37-48/64"** beam, **120 1/2"/d**, **GOR 380**, **TP 60**. Officially completed **3-14-57**.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Shell Oil Company**
Address **106 North Durand Avenue**
Farmington, New Mexico

By **B. W. Shepard**
B. W. Shepard
Title **Exploitation Engineer**

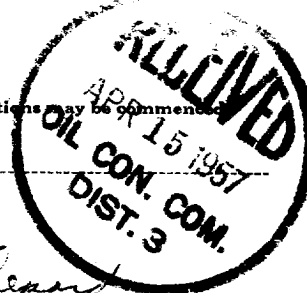

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

1000

