


Form 9-331a
(Feb. 1951)

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe, N.M.
Lease No. FE-070364
Unit Carson

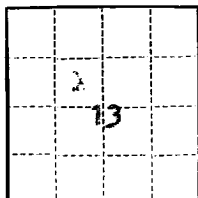

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	
<u>Notice of Conversion to Injector</u>	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 21, 1944

Carson Unit
Well No. 22-13 is located 1.00 ft. from N line and 1000 ft. from E line of sec. 13

SE 14 13 25 N. 13 E. Meridian
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Bisti San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

Relly Fishing
The elevation of the derrick floor above sea level is 6302.2 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Status: F.O. 5035', casing 6-5/8" at 121'; 4-1/2" at 5034'; Perit. 4 (1/2" holes/ft.) in intervals 4064-47, 4893-4901, 4943-53, 4962-70.

Proposed Work:

1. Pressure test tubing with 1000 psi for 15 min.
2. Pull tubing and bail clean.
3. Run 2-3/8" open-ended tubing to bottom and swab while running clean. Point back out water (treated with Triton X-100 detergent) down casing. When fluid clean up, pull tubing.
4. Run 2-3/8" tubing with packer ten feet above perforations.
5. Dump 60 bbls. of inhibited water down annulus to displace uninhibited fluid. Set packer and fill with inhibited water.
6. Run pressure and temperature surveys as directed.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company

Address Post Office Box 1200

Farmington, New Mexico

By _____

W. D. Marshall
Title Division Exploitation Engineer

