


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe, N. M.
Lease No. SE 078067
Unit Carson Unit

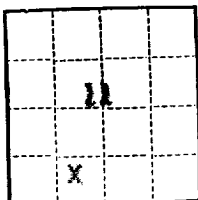

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENTS
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 26, 19 59

Carson Unit
Well No. 24-11 is located 660 ft. from S line and 1975 ft. from W line of sec. 11
06 SW 11 25 N 12 W 104th
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Bloti San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)


The elevation of the ~~derrick floor~~ Kelly Dishing above sea level is 6265 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 10-10-59

10-10-59 Ran and cemented (101') 8-5/8", 24#, J-35 casing at 110' with 100 sacks,
to 120 cu. ft., Portland cement treated with 2% calcium chloride, surface
10-11-59 temperature 45°. Formation temperature 75° ± estimated strength after
12 hrs. 1000 psi. Flanged up and waited on cement. Pressure tested
casing and BOP with 700 psi, OK.

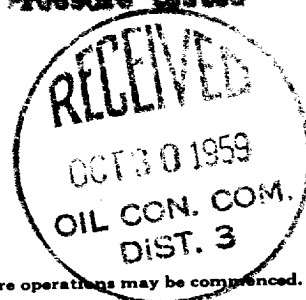

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company
Address P. O. Box 156
Farmington, New Mexico

By W. C. Miller
Exploitation Engineer
Title