

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe, N.M.

Lease No. SF 078063

Unit Carson Unit

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	X
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	X
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

January 20, 19 61

**Bisti Water Well**  
Well No. 2-2 is located 1922 ft. from N line and 2471 ft. from Ex W line of sec. 19

SE NW 19 25 N 11 W NMPM  
( $\frac{1}{4}$  Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Bisti San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)


**Kelly Bushing**  
The elevation of the ~~surface~~ above sea level is 6454 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Spudded 1-6-61

1-6-61 Ran and cemented 10-3/4", 40.5#, H-40 casing at 82' with 50 sacks cement to treated with 2% calcium chloride. Good cement returns to surface. Flanged 1-7-61 up and waited on cement. Pressure tested casing and BOP with 500 psi, OK.

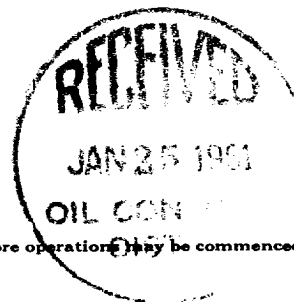

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Shell Oil Company

Address P. O. Box 1200  
Farmington, New Mexico

Original Signed By  
W. M. MARSHALL  
By W. M. Marshall

Title Division Exploitation Engineer