

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079357-B
Unit San Juan 26-1 Unit
14-G-001-101

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 17, 1957


Well No. 2 (HM) is located 993 ft. from S line and 00 ft. from W line of sec. 25
25 27N 01W 100W
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
No. Blanco Ext. & Blanco Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6524 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 2-13-57, Total Depth 3385'.
Ran 21 joints 7 5/8", J-55, 28.4#, casing (3371') set at 3383' with 100 sacks
regular cement, 100 sacks cement, 50# Floccs and 4 1/2 Gal, followed with 50
sacks 5# cement.
Held 1000, 30 minutes.
Top of cement by temperature survey at 1730'.

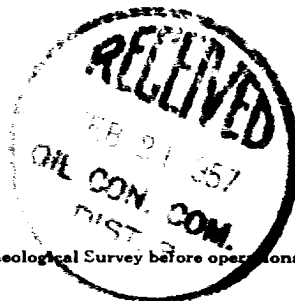

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company 1 Pisco Natural Gas Company

Address Box 997
Farmington, New Mexico

Original Signed ERNEST N. WAUGH

By _____

Title Petroleum Engineer