

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe

Lease No. \_\_\_\_\_

Unit SF 079527(A)

## SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....	X
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....	
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....	
NOTICE OF INTENTION TO ABANDON WELL.....		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 11, 1963

Champlin

Well No. 8-25 is located 1650 ft. from N line and 1650 ft. from E line of sec. 25SE 25  
( $\frac{1}{4}$  Sec. and Sec. No.)27N  
(Twp.)4W  
(Range)NMPM  
(Meridian)Basin Dakota  
(Field)Rio Arriba  
(County or Subdivision)New Mexico  
(State or Territory)

Tapicito Pictured Cliffs

The elevation of the derrick floor above sea level is 7354 ft. GL  
7366 KB


## DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drilled 7-7/8" hole to 8662'. Set 4-1/2" casing as liner at 8661', cemented with 520 sx. 20% Diacel and 110 sx regular with 4% gel. Top of liner at 4289'. Bumped plug with 1000 psi at 8:25 A.M., 7/25/63 - held okay.

8/25/63: Cleaned out to 8578', pressured up to 2600 psi at top of liner, pressure broke down at 1600 psi. Reran Baker packer and set at 4179', pressured up to 2000 psi, held okay. Squeezed top of liner with 75 sx of regular with 2% CaCl<sub>2</sub>. Squeeze pressure 2400 psi. Drilled cement to top of liner, pressured up to 3000 psi, liner held okay.

RECEIVED  
OCT 12 1963  
U. S. GEOLOGICAL SURVEY  
SARASOTA, NEW MEXICO

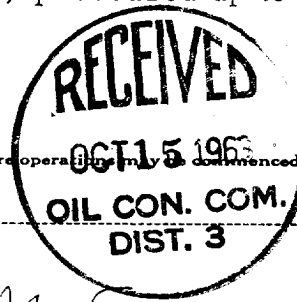

I understand that this plan of work must receive approval in writing by the Geological Survey before operations are commenced.

Company Consolidated Oil & Gas, Inc.Address 4150 East Mexico AvenueDenver 22, ColoradoBy [Signature]Title Chief Engineer