

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 37493-A
Unit San Juan 27-5 Unit
14-08-001-950

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

JUN 19 1958
U.S. GEOLOGICAL SURVEY
FARMINGTON, N.M.

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 16, 1958

Well No. 35 is located 1650 ft. from N line and 1550 ft. from E line of sec. 26
NE Sec. 26 34 24 N R.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco N.Y. & Tapacito Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)
P.C.

The elevation of the derrick floor above sea level is 5565 ft.

DETAILS OF WORK


(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

6-13-58. Total Depth 5707'.

Ran 70 joints 5 1/2", 15.50#, J-55 liner (2202') set from 3499' to 5701' with 125 sacks regular cement, 125 sacks Pozmix, 6 gal. followed by 50 sacks regular cement.

Held 1000# for 30 minutes.

Top of cement by temperature survey at 5100'.

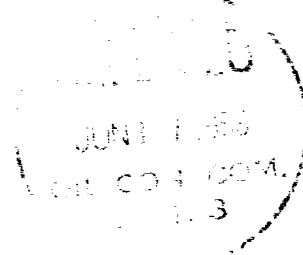

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 977

Farmington, New Mexico

Original Signed D. C. Johnston

By _____

Title Petroleum Engineer