

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**
Lease No. **080127**
Unit **Iberfano Unit**

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS

NOV 7 1958

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

November 3, 19 58

Well No. 100 is located 1650 ft. from S line and 1650 ft. from W line of sec. 22
SW Sec. 22 26N SW H.M.P.M.
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Dallard P.C. Ext. San Juan New Mexico
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6302 ft.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 10-31-58. Total Depth 2083'.
 Ran 51 joints 5 1/2", J-55, 15.50#, casing (2077') set at 2087' with 75 sacks regular cement, 75 sacks Pozmix, 25 cu. ft. Stratacrete, 2 1/2 Gal, followed with 50 sacks regular cement.

Held 1000# for 30 minutes.

Top of cement by temperature survey at 675'.

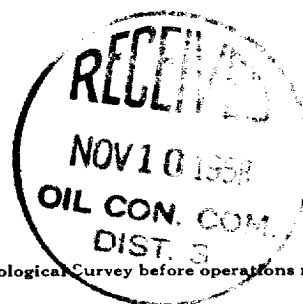

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By Original Signed D. W. Meehan

Title Petroleum Engineer