

NEW MEXICO OIL CONSERVATION COMMISSION
NORTHWEST NEW MEXICO PACKER-LEAKAGE TEST

Operator: <u>El Paso Natural Gas Company</u>				Well Identification: <u>Huerfano U. No. 104 GL-DK</u>			
Location of Well: <u>Unit 17 Sec. 17 Twp. 26 Rge. 10</u>				TYPE OF TEST: <u>1971</u>		☐ NEW ☐ C.W.O.	
UPPER COMPLETION	Reservoir or Pool: <u>GL</u>	☒ GAS ☐ OIL	☒ FLOWING ☐ ARTIFICIAL LIFT	☒ CASING ☐ TUBING			
LOWER COMPLETION	Reservoir or Pool: <u>DK</u>	☒ GAS ☐ OIL	☒ FLOWING ☐ ARTIFICIAL LIFT	☐ CASING ☒ TUBING			

Date	Lower Zone		Upper Zone			
	Shut-in		Shut-in		Flow Test	
	Casing	Tubing	Csg	Tbg	Tubing	Flow Rate
6-7	---	689	114	330		
6-8	---	739	209	332		
6-9	---	770	252	333		
6-9	---	773			186	329
6-10	---	792			102	330
					77	100
					29	100

Remarks:

The results of this test indicate (No Packer Leakage) (~~Packer Leakage~~) in this well.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

APPROVED: 11-29, 19 71
NEW MEXICO OIL CONSERVATION COMMISSION


BY: A. R. Kendrick
PETROLEUM ENGINEER DIST. NO. 3

OPERATOR: EL PASO NATURAL GAS COMPANY

BY: R. E. Fielder
R. E. Fielder
Well Test Engineer

DATE: 6-25-71



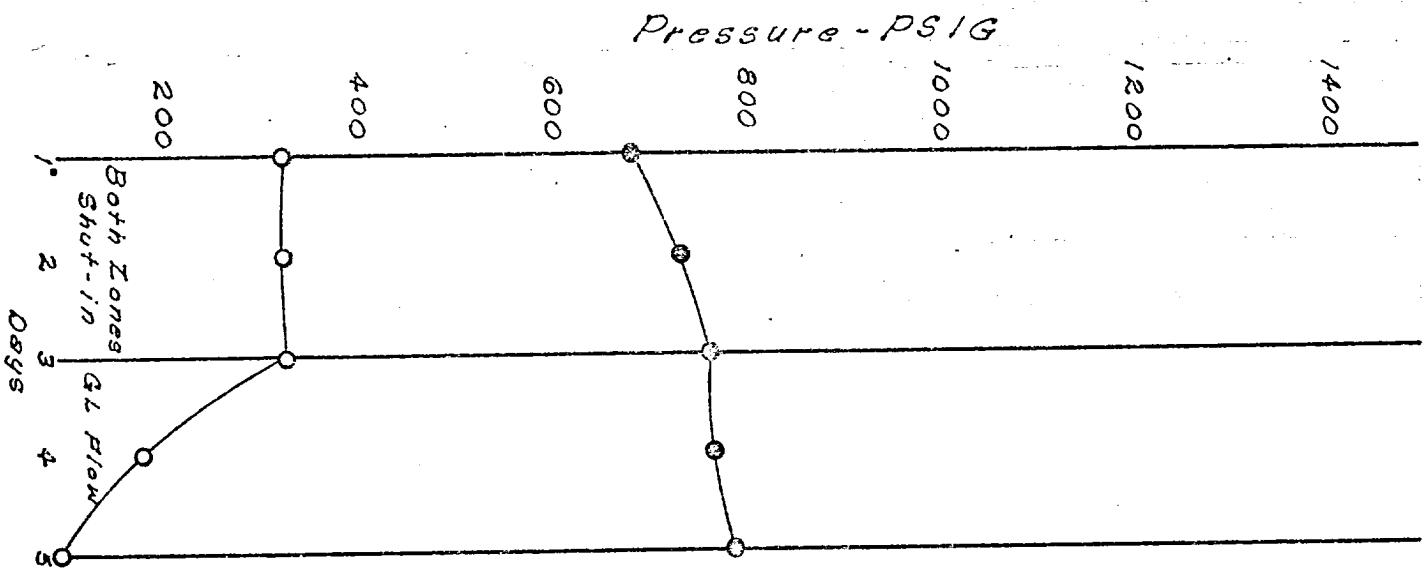

EPNG
 Annual Packer Leakage Test
 1971
 Huerfano Unit No. 104(GD)
 Unit P-5ec. 17-T26N-R10W
 San Juan County, New Mexico

○ GL Zone
 ● DK Zone