

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office SF  
Lease No. SF-078899-A  
Unit Western Pool Unit

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	Sandoil Price

X

INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA

June 2, 1961

Well No. 2-B is located 59.0 ft. from ~~N~~ S line and 1750 ft. from ~~E~~ W line of sec. 8  
SE/4 SW/4 Section 8 26N 11W NMPM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Basin Dakota San Juan New Mexico  
(Basin) (County) (State or Territory)


RECEIVED

The elevation of the derrick floor above sea level is 6177' ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

5-20-61 Total Depth 6278'. Clean Out Total Depth 6189'.  
Sandoil fractured Dakota through perforated intervals 6080'-6106' and 6114'-6120' with 50,400 gals. oil and 50,000# sand. Breakdown pressure 1700 psi. Maximum treating pressure 3100 psi. Average treating pressure 2700 psi. Injection Rate: 46.1 Bbls./Min. Flush with 6,384 gals.

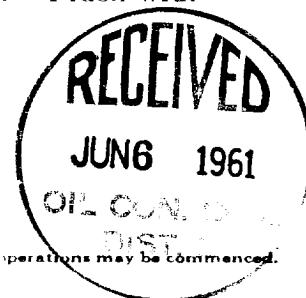

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Products Company  
Address Post Office Box 1560  
Farmington, New Mexico  
By  
Title Petroleum Engineer

ORIGINAL SIGNED BY: VAN E. DYKES