

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 8337 078476
Unit Ordad

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<u>Subsequent Report of Sand-water Frac</u>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 10, 1956

Well No. 2 is located 1650 ft. from S line and 1100 ft. from W line of sec. 15

NE SW 15
(1/4 Sec. and Sec. No.)

27-N
(Twp.)

8-W
(Range)

RMPN
(Meridian)

South Blanco P.C.
(Field)

San Juan
(County or Subdivision)


New Mexico
(State or Territory)

The elevation of the derrick floor above sea level is 5316 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Perforated $5\frac{1}{2}$ " casing at the following intervals with four jet shots per foot: 2076-2085, 2097-2117, 2136-2149. Fraced intervals with 40,000 gallons fresh water and 50,700 lbs. sand. Breakdown pressure was 1500 psi, treating pressure was 1400 psi at 50/bbls min injection rate. Final shut-in pressure was 700 psi.

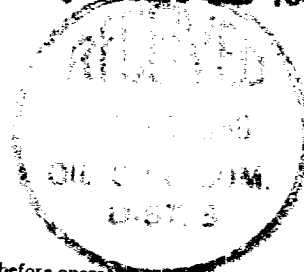

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company WESTERN NATURAL GAS COMPANY

Address 823 Midland Tower

Midland, Texas

By W. B. Cook

Title Petroleum Engineer