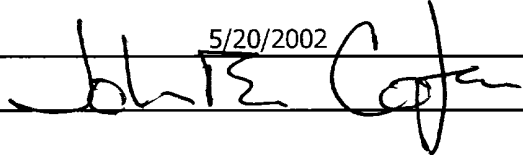


District I	State Of New Mexico	SUBMIT 1 COPY TO
P.O. Box 1980, Hobbs, NM	Energy, Minerals and Natural Resources Department	APPROPRIATE
District II		DISTRICT OFFICE
P.O. Drawer, Artesia, NM 88211	OIL CONSERVATION DIVISION	AND 1 COPY TO
District III	P.O. Box 2088	SANTA FE OFFICE
1000 Rio Brazos Rd. Aztec, NM 87410	Santa Fe, New Mexico 87504-2088	(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator:	Conoco Inc.	Telephone:	505-324-5837
Address:	3315 Bloomfield Hwy - Farmington, NM 87401		
Facility Or:	San Juan 28-7 #72		
Well Name			
Location:	Unit or Qtr/Qtr Sec	Unit L	Sec 35 T 28N R 7W County Rio Arriba
Pit Type:	Separator	Dehydrator	Other TDP
Land Type:	BLM	X	State Fee Other
Pit Location: (Attach diagram)	Pit dimension:	length 8'	width 8' depth 6'
	Reference:	wellhead X	other
	Footage from reference:	200'	
	Direction from reference:	90 Degrees	X East of North West South

Depth To Ground Water: (Vertical distance from contaminants to seasonal high water elevation of ground water)	Less than 50 feet	(20 points)	
	50 feet to 99 feet	(10 points)	
	Greater than 100 feet	(0 points)	
	Total		0
Wellhead Protection Area: (Less than 200 feet from a private domestic water source, or; less than 1000 feet from all other water sources)	Yes	(20 points)	
	No	(0 points)	
	Total		0
Distance To Surface Water: (Horizontal distance to perennial lakes, ponds, rivers, streams, creeks, irrigation canals and ditches)	Less than 200 feet	(20 points)	(20 points)
	200 feet to 1000 feet	(10 points)	(10 points)
	Greater than 1000 feet	(0 points)	(0 points)
	Total		0
	RANKING SCORE (TOTAL POINTS):		0

Date Remediation Started: <u> </u> No Remediation Necessary <u> </u>		Date Completed: <u> </u> N/A <u> </u>	
Remediation Method: (Check all appropriate sections)	Excavation: <u> </u>	Approx. cubic yards <u> </u>	
	Landfarm <u> </u>	Insitu Bioremediation <u> </u>	
	Other <u> </u>		
Remediation Location: <u> </u> Onsite <u> </u> Offsite <u> </u>			
(ie. landfarmed onsite, name and location of offsite facility)			
General Description Of Remedial Action: <u> </u>			
Ground Water Encountered: <u> </u> No <u> </u> X <u> </u> Yes <u> </u>		Depth <u> </u>	
Final Pit:	Sample location <u> </u> Center of Pit Bottom <u> </u>		
Closure Sampling:	<u> </u> Composite sample taken from pit sides. <u> </u>		
(if multiple samples attach sample results and diagram of sample locations and depths)	Sample depth <u> </u>		3' <u> </u>
	Sample date <u> </u> 9/18/2001 <u> </u>		Sample time <u> </u> 1:30 PM <u> </u>
	Sample Results		
	Benzene (ppm) <u> </u> 0.0236 <u> </u>		
Total BTEX (ppm) <u> </u> 0.04 <u> </u>			
Field headspace (ppm) <u> </u> 2 <u> </u>			
TPH <u> </u> 35 <u> </u>			
Ground Water Sample: <u> </u> Yes <u> </u> No <u> </u> X <u> </u>		(If yes, attach sample results)	
I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF			
DATE <u> </u> 5/20/2002 <u> </u>		PRINTED NAME <u> </u> John E. Cofer <u> </u>	
SIGNATURE <u> </u>  <u> </u>		AND TITLE <u> </u> Environmental Coordinator <u> </u>	

ENVIROTECH LABS

PRAGMATIC SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	97070-003-336
Sample ID:	TDP Center	Date Reported:	09-25-01
Laboratory Number:	21036	Date Sampled:	09-18-01
Chain of Custody:	9387	Date Received:	09-20-01
Sample Matrix:	Soil	Date Analyzed:	09-25-01
Preservative:	Cool	Date Extracted:	09-20-01
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	23.6	1.8
Toluene	ND	1.7
Ethylbenzene	6.0	1.5
p,m-Xylene	ND	2.2
o-Xylene	10.3	1.0
Total BTEX	39.9	


ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	95 %
	1,4-difluorobenzene	95 %
	Bromochlorobenzene	95 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28-7 #72 OVM 2.0 ppm.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	97070-003-336
Sample ID:	TDP Sides	Date Reported:	09-25-01
Laboratory Number:	21037	Date Sampled:	09-18-01
Chain of Custody:	9387	Date Received:	09-20-01
Sample Matrix:	Soil	Date Analyzed:	09-25-01
Preservative:	Cool	Date Extracted:	09-20-01
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	ND	1.8
Toluene	ND	1.7
Ethylbenzene	ND	1.5
p,m-Xylene	ND	2.2
o-Xylene	ND	1.0
Total BTEX	ND	


ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	95 %
	1,4-difluorobenzene	95 %
	Bromochlorobenzene	95 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28-7 #72 OVM 0 ppm.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	97070-003-336
Sample ID:	TDP Center	Date Reported:	09-25-01
Laboratory Number:	21036	Date Sampled:	09-18-01
Chain of Custody No:	9387	Date Received:	09-20-01
Sample Matrix:	Soil	Date Extracted:	09-20-01
Preservative:	Cool	Date Analyzed:	09-25-01
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	25.2	0.2
Diesel Range (C10 - C28)	9.6	0.1
Total Petroleum Hydrocarbons	34.8	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28-7 #72 OVM 2.0 ppm.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	97070-003-336
Sample ID:	TDP Sides	Date Reported:	09-25-01
Laboratory Number:	21037	Date Sampled:	09-18-01
Chain of Custody No:	9387	Date Received:	09-20-01
Sample Matrix:	Soil	Date Extracted:	09-20-01
Preservative:	Cool	Date Analyzed:	09-25-01
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	20.8	0.2
Diesel Range (C10 - C28)	9.0	0.1
Total Petroleum Hydrocarbons	29.8	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28-7 #72 OVM 0 ppm.


Analyst


Review

09387

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615

Lease Name: San Juan 28-7 #72 PC/MV Dual

Operator: Conoco

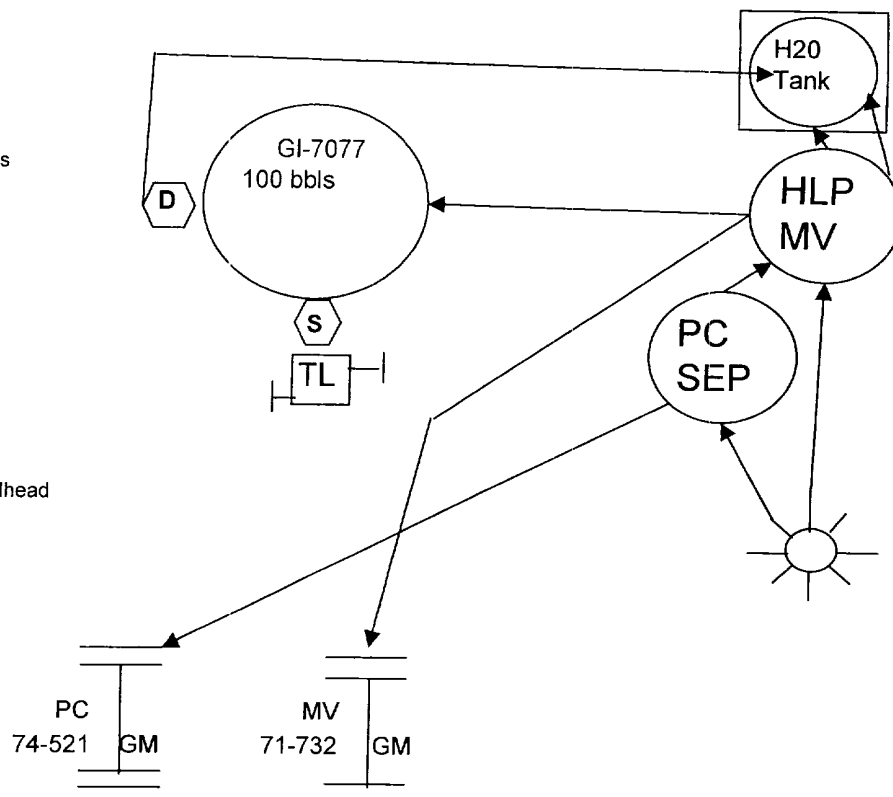
Date: 9/12/2000

Site Security
(Indicate North)

N

Old oil tank drain tank pit - 155' & 110 degrees
from wellhead.

Old vent tank pit - 200' & 90 degrees from wellhead



Lease Name: San Juan 28-7 #72

Federal/ Indian Lease No: SF-078496

CA No.: _____

Unit : L

Legal Description: 28N- 7W- 35 1650' FSL & 1090' FWL

County: Rio Arriba

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM