Form 9-331 b
(April 1952)

(SUBMIT IN TRIPLICATE)

Indian Agency __Jicarilla__

__Apache__

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Allottee

Lease No. __Contract V25__

__Boulder Lease__

RECEIVED
DEC 21 1961
U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO REDRILL OR REPAIR WELL		SUBSEQUENT REPORT OF REDRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

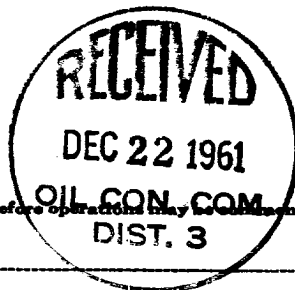(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

__December 18,__ , 19 __61__

Well No. __Boulder 14-23__ is located __130 ft.__ from {N/S} line and __390 ft.__ from {E/W} line of sec. __23__

__SW/4 Sec. 23__	__26N__	__1W__	__NMPM__
(¼ Sec. and Sec. No.)	(Twp.)	(Range)	(Meridian)
__Boulder-Mancos__	__Rio Arriba__		__NM__
(Field)	(County or Subdivision)		(State or Territory)

The elevation of the ~~derrick floor~~ KB above sea level is __7203__ ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

Drld 6¼" hole from 3774' (7" shoe) to 5091', TD, w/ air.
Landed 45 jts (1448') of 4½", 9.50 and 11.60, J-55 liner @ 5075'; top
liner hung on Burns pack-off hanger @ 3627'. Liner perf'd w/ 4 -1/2" x 3"
slots/ft from 4944'/5075'. Cmtd liner thru pkr collar @ 4881' w/ 12 sx
+ 2% CaCl₂, PD @ 7:30 PM 11/30/61. Tested liner w/ 1000 psi for 30 min;
OK. Cleaned out cmt & pkr collar. Prep frac.

RECEIVED
DEC 22 1961
OIL CON. COM.
DIST. 3

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company __Socony Mobil Oil Company, Inc.__

Address __P. O. Box 3371__

__Durango, Colorado__

By __P. M. Barry__

Title __Ast. Prod. Supt.__

USGS Fmn	5
CMR	1
Oyo Prod	1