

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office New Mexico  
Lease No. 03853  
Unit San Juan 23-4 Unit  
14-03-001-933

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	<input checked="" type="checkbox"/>
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

July 7, 1958

Well No. 15-29 is located 990 ft. from N line and 990 ft. from W line of sec. 29  
SW Sec. 29 20N 4W T.M.P.M.  
 (4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Blanco N.V. Rio Arriba New Mexico  
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 7045 ft.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 6-30-58. Total Depth 4302'.  
 Ran 137 joints 7 5/8", J-55 25.40', casing (4300') set at 4300' with 75 sacks  
 regular cement, 75 sacks Formula, 3 1/2 Floccule and 2 1/2 Gal, followed with 50  
 sacks Best cement with 2 1/2 Gal.

Held 1000' for 30 minutes.

Top of cement by temperature survey at 3200'.

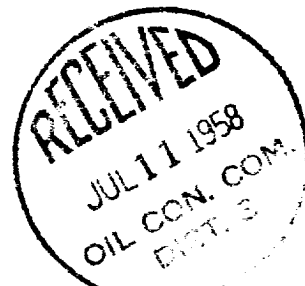

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 937  
Farmington, New Mexico

By Original Signed D. C. Johnston

Title Petroleum Engineer