

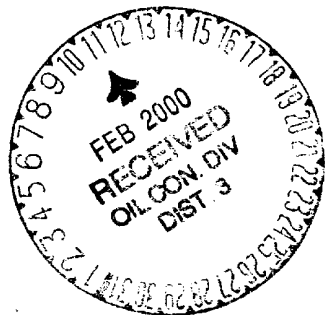
OK

District I P.O. Box 1980, Hobbs, NM District II P.O. Drawer, Artesia, NM 88211 District III 1000 Rio Brazos Rd. Aztec, NM 87410	State Of New Mexico Energy, Minerals and Natural Resources Department OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088	SUBMIT 1 COPY TO APPROPRIATE DISTRICT OFFICE AND 1 COPY TO SANTA FE OFFICE (Revised 3/9/94)
--	--	--

PIT REMEDIATION AND CLOSURE REPORT

Operator: <u>Conoco Inc.</u>		Telephone: <u>505-324-5813</u>	
Address: <u>3315 Bloomfield Hwy - Farmington, NM 87401</u>			
Facility Or: <u>San Juan 28-7 #32</u>			
Well Name			
Location:	Unit or Qtr/Qtr Sec	<u>L</u> Sec <u>19</u> T <u>28N</u> R <u>7W</u> County <u>Rio Arriba</u>	
Pit Type:	Separator ☒	Dehydrator ☐	Other ☐
Land Type:	BLM ☐ State ☒	Fee ☐	Other ☐
Pit Location: (Attach diagram)	Pit dimension:	length <u>15'</u>	width <u>15'</u> depth <u>3'</u>
	Reference:	wellhead ☒	other ☐
	Footage from reference:	<u>90'</u>	
	Direction from reference:	<u>60°</u> Degrees ☒	East of ☒ North West ☐ South

Depth To Ground Water: (Vertical distance from contaminants to seasonal high water elevation of ground water)	<table style="width:100%;"> <tr> <td>Less than 50 feet</td> <td>(20 points)</td> </tr> <tr> <td>50 feet to 99 feet</td> <td>(10 points)</td> </tr> <tr> <td>Greater than 100 feet</td> <td>(0 points)</td> </tr> <tr> <td colspan="2" style="text-align: right;">Total <u>0</u></td> </tr> </table>	Less than 50 feet	(20 points)	50 feet to 99 feet	(10 points)	Greater than 100 feet	(0 points)	Total <u>0</u>								
Less than 50 feet	(20 points)															
50 feet to 99 feet	(10 points)															
Greater than 100 feet	(0 points)															
Total <u>0</u>																
Wellhead Protection Area: (Less than 200 feet from a private domestic water source, or; less than 1000 feet from all other water sources)	<table style="width:100%;"> <tr> <td>Yes</td> <td>(20 points)</td> </tr> <tr> <td>No</td> <td>(0 points)</td> </tr> <tr> <td colspan="2" style="text-align: right;">Total <u>0</u></td> </tr> </table>	Yes	(20 points)	No	(0 points)	Total <u>0</u>										
Yes	(20 points)															
No	(0 points)															
Total <u>0</u>																
Distance To Surface Water: (Horizontal distance to perennial lakes, ponds, rivers, streams, creeks, irrigation canals and ditches)	<table style="width:100%;"> <tr> <td>Less than 200 feet</td> <td>(20 points)</td> <td>(20 points)</td> </tr> <tr> <td>200 feet to 1000 feet</td> <td>(10 points)</td> <td>(10 points)</td> </tr> <tr> <td>Greater than 1000 feet</td> <td>(0 points)</td> <td>(0 points)</td> </tr> <tr> <td colspan="2" style="text-align: right;">Total <u>0</u></td> <td></td> </tr> <tr> <td colspan="3" style="text-align: right;">RANKING SCORE (TOTAL POINTS): <u>0</u></td> </tr> </table>	Less than 200 feet	(20 points)	(20 points)	200 feet to 1000 feet	(10 points)	(10 points)	Greater than 1000 feet	(0 points)	(0 points)	Total <u>0</u>			RANKING SCORE (TOTAL POINTS): <u>0</u>		
Less than 200 feet	(20 points)	(20 points)														
200 feet to 1000 feet	(10 points)	(10 points)														
Greater than 1000 feet	(0 points)	(0 points)														
Total <u>0</u>																
RANKING SCORE (TOTAL POINTS): <u>0</u>																



Date Remediation Started: November 11, 1999 Date Completed: November 11, 1999

Remediation Method: Excavation: _____ Approx. cubic yards _____
(Check all appropriate sections)
Landfarm _____ Insitu Bioremediation _____
Other _____

Remediation Location: Onsite _____ Offsite _____
(ie. landfarmed onsite,
name and location of
offsite facility)

General Description Of Remedial Action: Took sample 3' below bottom of pit.

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit: Sample location Center of pit 3' below.

Closure Sampling: _____

(if multiple samples Sample depth 3' below bottom
attach sample results

and diagram of sample Sample date Nov. 11, 1999 Sample time 2:00pm
locations and depths)

Sample Results

Benzene (ppm) .0059

Total BTEX (ppm) .0375

Field headspace (ppm) not taken

TPH 4.6

Ground Water Sample: Yes _____ No ☒ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF

DATE February 8, 2000 PRINTED NAME Shirley L. Ebert

SIGNATURE Shirley Ebert AND TITLE SHEAR Specialist

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	707003-115
Sample ID:	H2O Pit	Date Reported:	11-16-99
Laboratory Number:	G404	Date Sampled:	11-11-99
Chain of Custody No:	7212	Date Received:	11-15-99
Sample Matrix:	Soil	Date Extracted:	11-15-99
Preservative:	Cool	Date Analyzed:	11-15-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	0.3	0.2
Diesel Range (C10 - C28)	4.3	0.1
Total Petroleum Hydrocarbons	4.6	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28 - 7 # 32.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	707003-115
Sample ID:	H2O Pit	Date Reported:	11-16-99
Laboratory Number:	G404	Date Sampled:	11-11-99
Chain of Custody:	7212	Date Received:	11-15-99
Sample Matrix:	Soil	Date Analyzed:	11-15-99
Preservative:	Cool	Date Extracted:	11-15-99
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	5.9	0.9
Toluene	1.9	0.8
Ethylbenzene	12.4	0.8
p,m-Xylene	9.0	1.1
o-Xylene	8.3	0.5
Total BTEX	37.5	


ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	100 %
	Bromofluorobenzene	100 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28 - 7 # 32.


Analyst


Review

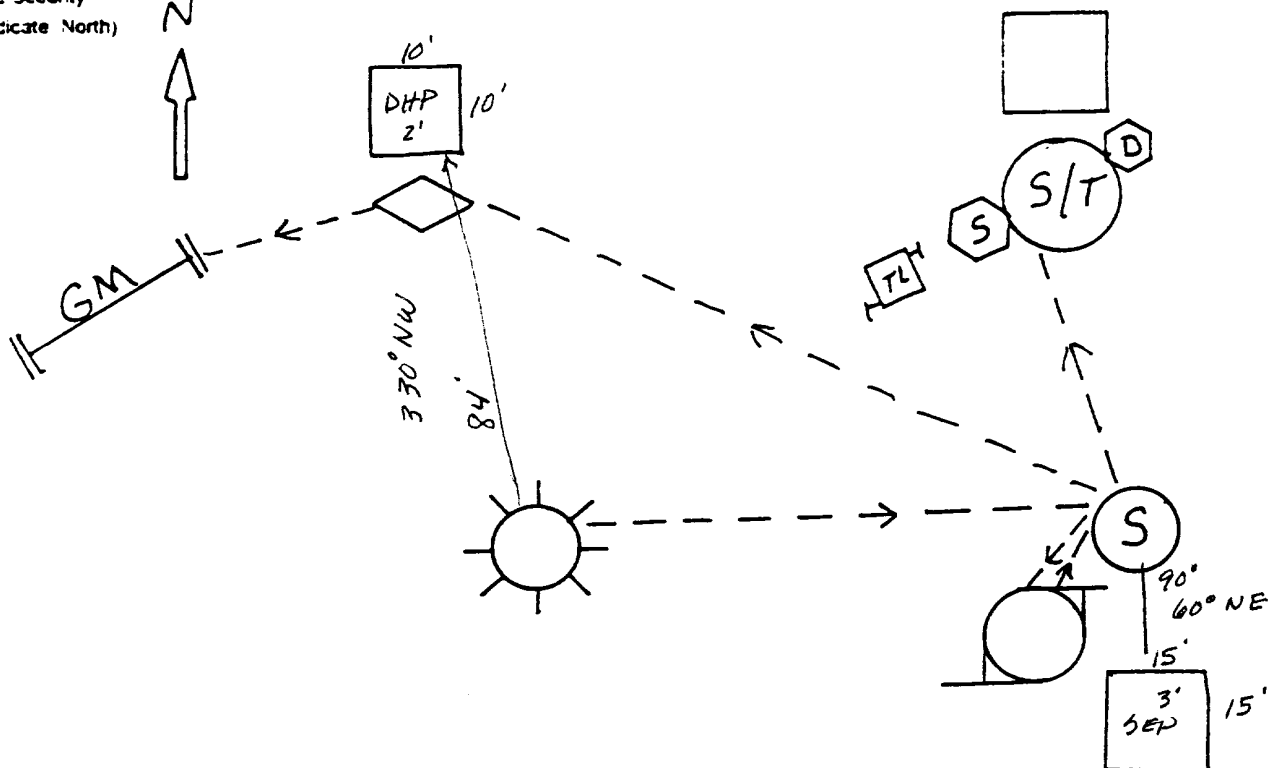
7212

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615

Lease Name: SAN JUAN 28-7 #32 Operator: AUGIE Date: 4-30-98

Site Security
(Indicate North)



Lease Name: SAN JUAN 28-7 #32

Federal/ Indian Lease No: SF 078500A

CA No.: _____

Unit: 1

Legal Description: Sect: 19 TP: 28N R: 7W

County: Rio Arriba, NM

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM