

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 079289  
Unit NW 1/4 of SE 1/4 of  
Section 14

# SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	XX
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL		

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

San Juan Unit 28-7 Well \_\_\_\_\_, 19\_\_\_\_  
Well No. 136 is located 1650 ft. from N line and 1650 ft. from E line of sec. 14  
SE 1/4 Sec. 14 28N 7W NMPM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Wildcat Rio Arriba New Mexico  
(Field) (County or Subdivision) (State or Territory)


The elevation ~~of the Black Rock Mountain~~ is 6490 ft. G.L.

**RECEIVE**  
APR 4 1963

## DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudlogging, logging points, and all other important proposed work)

Well spudded 3/29/63, drilled 12 1/2" hole to T.D. of 371' and reamed to 17 1/2".  
Ran 13-3/8" 48# H-40 casing landed 363' w/300 ax. cement w/full returns to surf.  
Casing pressured to 500# for 30 minutes. Held O.K., drilled plug, BOP closed and  
hole pressured to 500# w/no drop in pressure. Now drilling ahead.

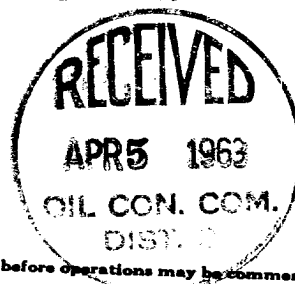

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Delhi-Taylor Oil Corporation

Address P. O. Drawer 1198

Farmington, New Mexico

Original signed by  
By A. R. Gibson  
A. R. Gibson  
Title Dist. Superintendent