


LOCATION				Date	7-11-53
FIELD Wildcat				Ticket No.	78931
COUNTY Rio Arriba				HOWCO DISTRICT	Farmington
STATE New Mexico		HOLE & TOOL DATA		Kind of Job	Open Hole
CONTRACTOR Moran Drlg. Co.		Total Depth	3375'	Casing Perforations	Top Bottom
		Top Packer Depth	3327'	Bottom Packer Depth	3330'
MUD DATA		Casing or Hole Size	8-3/4"	Liner or Rathole Size	-
Kind Aquagel		Formation Tested Pictured Cliff		Safety Joint	\$ 15.00
Weight 10.2 lbs.-gal.		Size Drill Pipe	4 1/2" E.H.	Size Drill Collars	6 1/2" x 270' 4 1/2" E.H.
Viscosity 80 Sec.		Size Bottom Choke	1 1/2"	Size Surface Choke	1"
Filter Loss 10 c. c. Filter Cake 2/32 in.		Size Tool Valve	1"	Size Pilot Valve	-
BT. P.R.D. No. 349 Blanked Off No		Size Hook Wall Packer	-	Size Rings	-
12 Hr. Clock No. 1136		Size D. E. Wall Packer	8" D.E.W.P.	No. Packers	2
Est. Gauge Depth Temp. 100 °F		PRD Device No.	3086	Blanked Off	Yes
Pressure Readings Field Office Corrected		Size & Length Anchor 45' HOWCO ANCHOR		Witnessed By	Mileham & Hite
Initial Hydro Mud Pressure 1782 p.s.i.		REMARKS: Testing for oil & gas. Opened tool with good blow and continued			
Initial Flow Pres. 40 p.s.i.		throughout test. Recovered 45' drlg. fluid slightly gas cut.			
Tool Open 1 Hr. 30 Min.					
Final Flow Pres. 28 p.s.i.					
Time Closed In 30 Min.					
Closed in Pres. 108 p.s.i.					
Final Hydro Mud Pressure 1762 p.s.i.		Amount of Cushion None		All depths measured from	Rotary Table
				No. Folders Reproduced	5

TIME

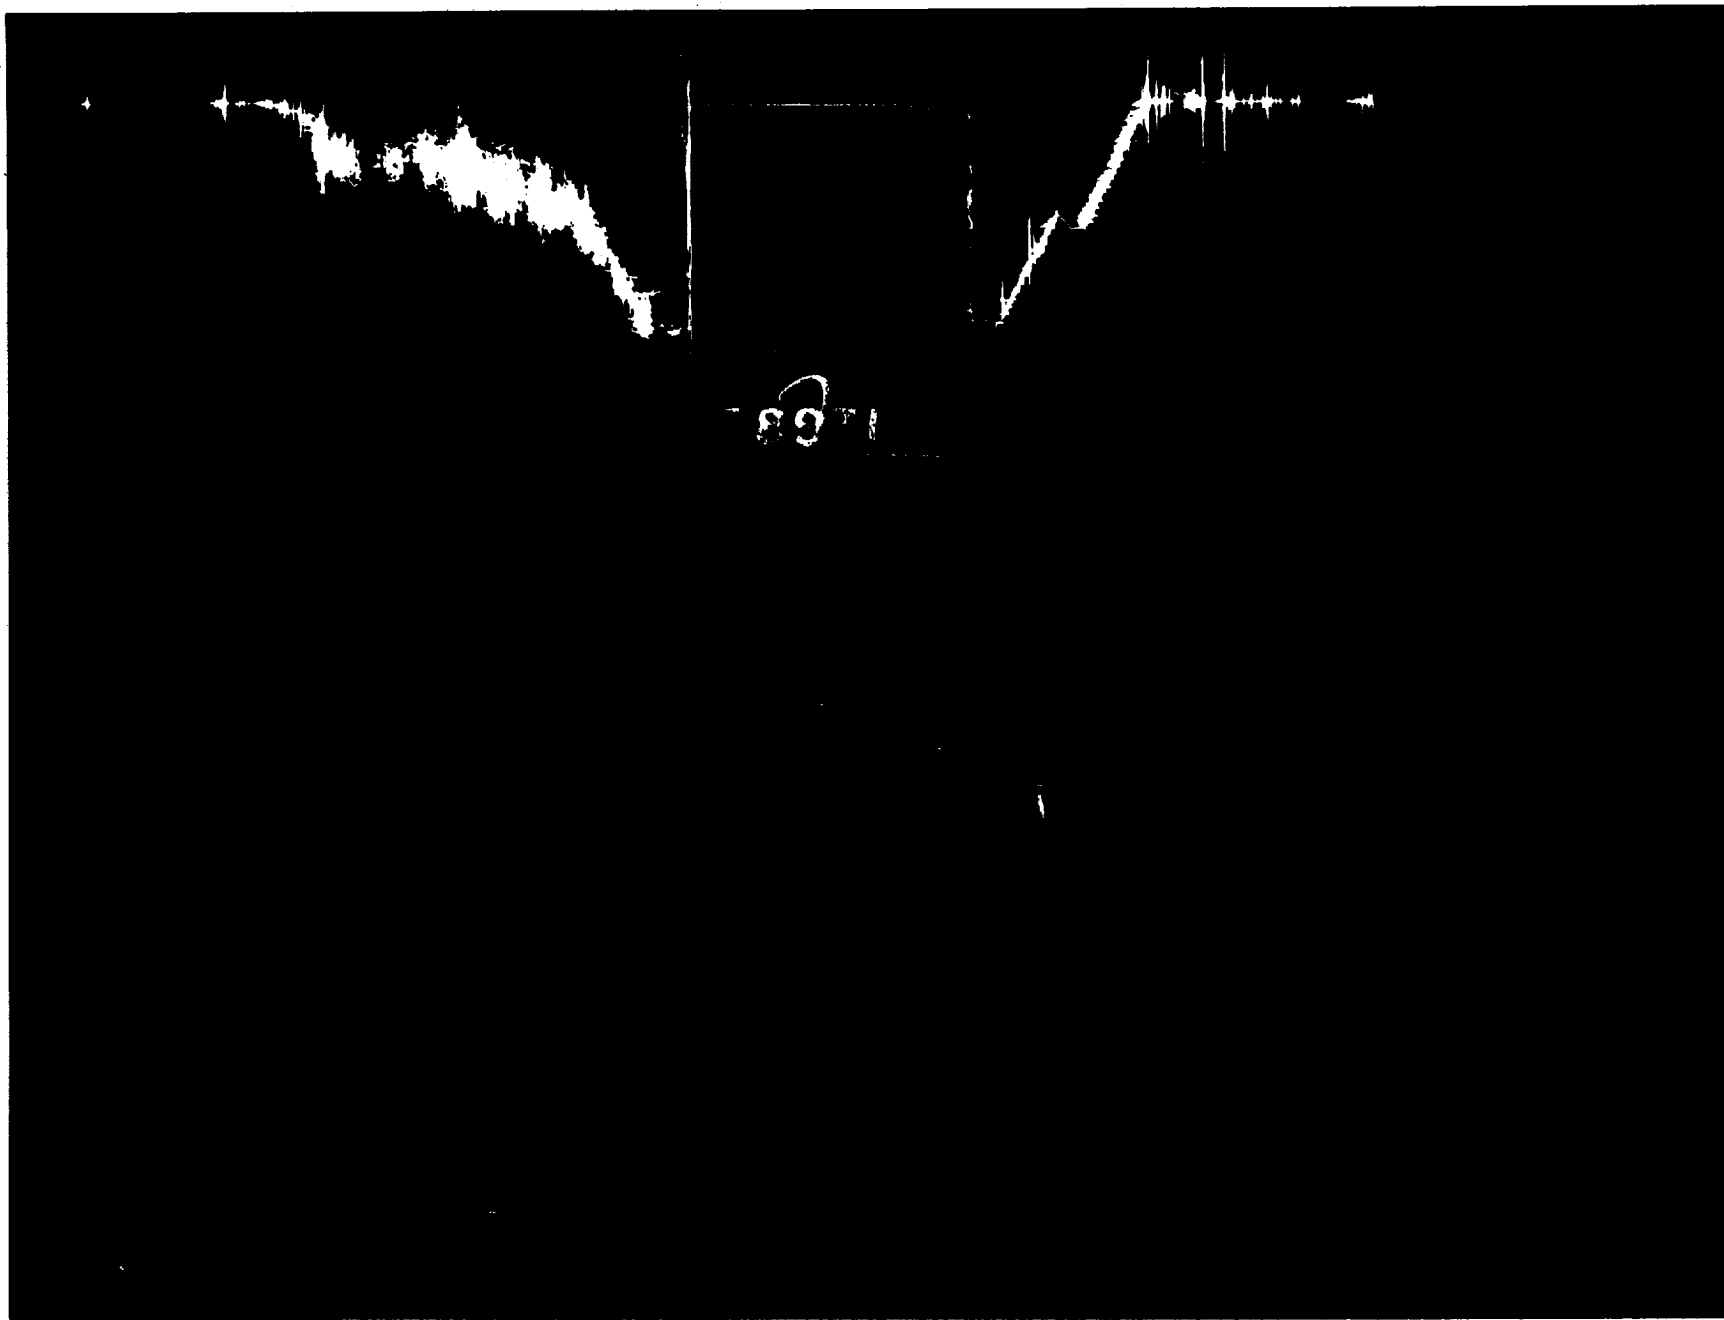

Each Horizontal Line Equal to 1000 p.s.i.

30-039 07435



OIL WELL CEMENTING CO.

Formation Testing
"Service Report"
