

(SUBMIT IN TRIPPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 079250
Unit San Juan 20-5 Unit
14-06-001-943

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 20, 1951

Well No. 10 is located 320 ft. from N line and 350 ft. from E line of sec. 10

14 Sec. and Sec. No.) 24 (Twp.) 7 (Range) N.M.P.M. (Meridian)
Blanco (Field) Alto Arriba (County or Subdivision) New Mexico (State or Territory)


The elevation of the derrick floor above sea level is 3012 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

10-2-51 Total depth 5920'.
Ran 149 joints 5 1/2", 15.50 lb., J-55 casing (5914') set at 5924' with
150 sacks regular cement, 150 sacks Pozmix, 4 1/2 Gal., 1/16 Flocele/sk.
Held 1000 for 30 minutes.

Top of cement by temperature survey at 3370'.

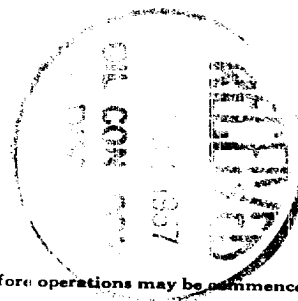

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 551

Farmington, New Mexico

Original Signed D. C. Johnston
By

Title Petroleum Engineer