


Land Office Santa Fe
Lease No. 079727
Unit San Juan 28-4 Unit
14-08-001-933

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

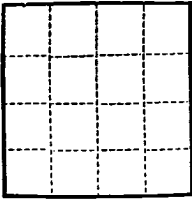

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	Water Frac	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

December 1, 1959

Well No. 21-7 is located 815 ft. from S line and 1475 ft. from W line of sec. 7


SW/4 Sec. 7 28N 4W N.M.P.M.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Blanco Mesa Verde Rio Arriba New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 7390 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

11-21-59 Total Depth 6777'. C.O.T.D. 6728'. Water fractured Menefee perf. int. 6480-90 and Point Lookout perf. int. 6519-26; 6534-41; 6566-76; 6600-14; 6622-32 (2 DJ/ft.) w/76,188 gallons water and 60,000# sand. BD pr. 3000#, max. pr. 3000#, avg. tr. pr. 1300-1400-1500-2000-1900#. Injection rate 78 BPM. Flush 12,180 gallons. Injected 5 sets of 16 balls each.

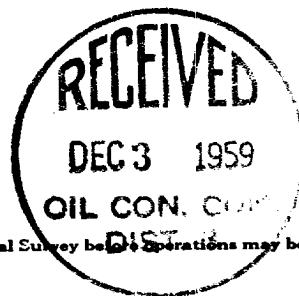

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By ORIGINAL SIGNED H.E. McANALLY

Title Petroleum Engineer