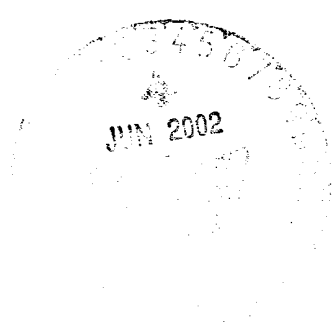


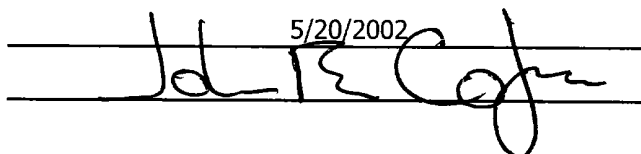
04

District I P.O. Box 1980, Hobbs, NM District II P.O. Drawer, Artesia, NM 88211 District III 1000 Rio Brazos Rd. Aztec, NM 87410	State Of New Mexico Energy, Minerals and Natural Resources Department OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088	SUBMIT 1 COPY TO APPROPRIATE DISTRICT OFFICE AND 1 COPY TO SANTA FE OFFICE (Revised 3/9/94)
PIT REMEDIATION AND CLOSURE REPORT		

Operator: <u>Conoco Inc.</u>		Telephone: <u>505-324-5837</u>	
Address: <u>3315 Bloomfield Hwy - Farmington, NM 87401</u>			
Facility Or: <u>San Juan 28-7 #193</u>			
Well Name _____			
Location:	Unit or Qtr/Qtr Sec	Unit M Sec	28 T <u>27</u> N R <u>7</u> County Rio Arriba
Pit Type:	Separator _____	Dehydrator _____	Other <u>TDP</u>
Land Type:	BLM <u>X</u> State _____	Fee _____	Other _____
Pit Location: (Attach diagram)	Pit dimension:	length <u>6'</u>	width <u>6'</u> depth <u>2'</u>
	Reference:	wellhead <u>X</u>	other _____
	Footage from reference:	<u>140'</u>	
	Direction from reference:	<u>270</u> Degrees	East of _____ North _____ West of _____ South

Depth To Ground Water: (Vertical distance from contaminants to seasonal high water elevation of ground water)	Less than 50 feet	(20 points)	
	50 feet to 99 feet	(10 points)	
	Greater than 100 feet	(0 points)	
	Total		<u>0</u>
Wellhead Protection Area: (Less than 200 feet from a private domestic water source, or; less than 1000 feet from all other water sources)	Yes	(20 points)	
	No	(0 points)	
	Total		<u>0</u>
Distance To Surface Water: (Horizontal distance to perennial lakes, ponds, rivers, streams, creeks, irrigation canals and ditches)	Less than 200 feet	(20 points)	(20 points)
	200 feet to 1000 feet	(10 points)	(10 points)
	Greater than 1000 feet	(0 points)	(0 points)
	Total		<u>0</u>
RANKING SCORE (TOTAL POINTS):			<u>0</u>



Date Remediation Started: _____		No Remediation Necessary _____		Date Completed: _____		N/A	
Remediation Method: _____		Excavation: _____		Approx. cubic yards _____			
(Check all appropriate sections)							
		Landfarm _____		Insitu Bioremediation _____			
		Other _____					
Remediation Location: _____		Onsite _____		Offsite _____			
(ie. landfarmed onsite, name and location of offsite facility)							
General Description Of Remedial Action: _____							
Ground Water Encountered: _____		No _____		X _____		Yes _____	
		Depth _____					
Final Pit: _____		Sample location _____		Center of Pit Bottom			
Closure Sampling: _____							
(if multiple samples attach sample results and diagram of sample locations and depths)		Sample depth _____		3'			
		Sample date _____		10/27/2001		Sample time _____	
						2:15 PM	
Sample Results							
		Benzene (ppm) _____		ND			
		Total BTEX (ppm) _____		0.0298			
		Field headspace (ppm) _____		N/A			
		TPH _____		ND			
Ground Water Sample: _____		Yes _____		No _____		X _____	
		(If yes, attach sample results)					
I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST OF MY KNOWLEDGE AND BELIEF							
DATE _____		5/20/2002		PRINTED NAME _____		John E. Cofer	
SIGNATURE _____				AND TITLE _____		Environmental Coordinator	

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	97070-003-411
Sample ID:	Drain Pit	Date Reported:	11-05-01
Laboratory Number:	21399	Date Sampled:	10-27-01
Chain of Custody:	9607	Date Received:	11-01-01
Sample Matrix:	Soil	Date Analyzed:	11-05-01
Preservative:	Cool	Date Extracted:	11-05-01
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	ND	1.8
Toluene	ND	1.7
Ethylbenzene	7.2	1.5
p,m-Xylene	ND	2.2
o-Xylene	22.6	1.0
Total BTEX	29.8	


ND - Parameter not detected at the stated detection limit.


Surrogate Recoveries:	Parameter	Percent Recovery
	Fluorobenzene	97 %
	1,4-difluorobenzene	97 %
	Bromochlorobenzene	97 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28 - 7 #193 3' Bottom Center.


Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	97070-003-411
Sample ID:	Drain Pit	Date Reported:	11-05-01
Laboratory Number:	21399	Date Sampled:	10-27-01
Chain of Custody No:	9607	Date Received:	11-01-01
Sample Matrix:	Soil	Date Extracted:	11-05-01
Preservative:	Cool	Date Analyzed:	11-05-01
Condition:	Cool and Intact	Analysis Requested:	8015 TPH


Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	ND	0.2
Diesel Range (C10 - C28)	ND	0.1
Total Petroleum Hydrocarbons	ND	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: 28-7 #193 3' Bottom Center.


Analyst


Review

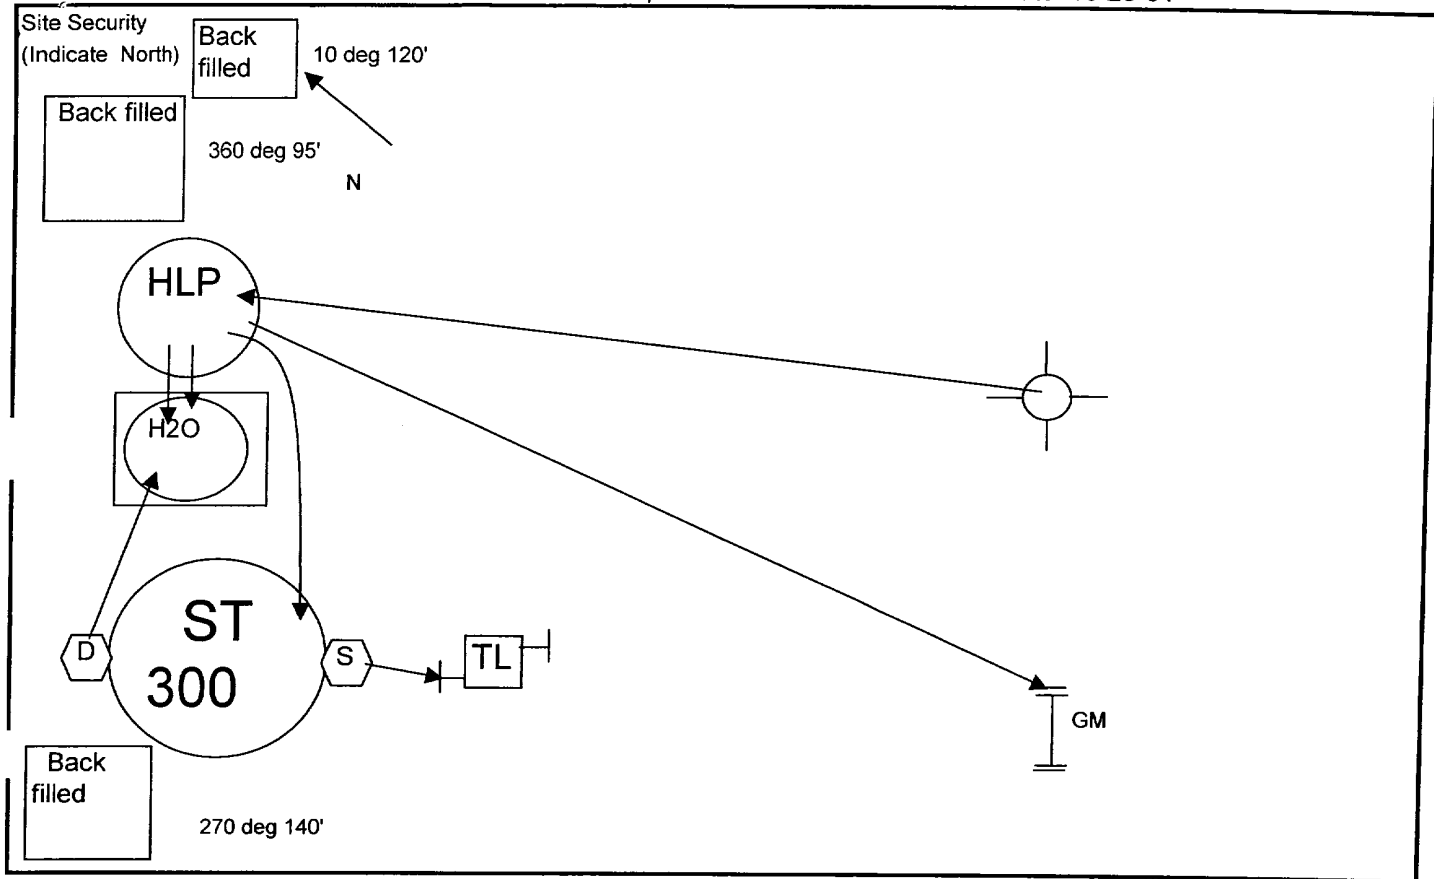
09607

[illegible]

Lease Name: San Juan 28-7 # 193

Operator: David Hartman

Date: 10-25-01



Lease Name: San Juan 28-7 #193

Federal/ Indian Lease No:

SF 078498

CA No.:

Unit : M

Legal Description: S-28, T-27N, R-7W

County: Rio Arriba County

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valve:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM