
Denny S. Fourt

DEC 2 9 1997

Meter Number:90200
Location Name:VALENCIA CANYON UNIT #25

Location:TN-28 RG-04
SC-15 UL-N
2 - Federal

NMOCD Zone: OUTSIDE Hazard Ranking Score: 00

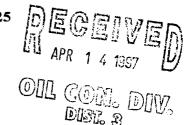

RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone 10^{-9} to 10^{-13} cm/sec Shale 10^{-12} to 10^{-16} cm/sec Clay 10^{-12} to 10^{-15} cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.

FIELD PIT SITE ASSESSMENT FORM ELP



GENERAL	Meter: 90-200 Location: VALENCIA CANYIN UNIT #25 Operator #: 0203 Operator Name: AMOCO P/L District: BCONFRECTO Coordinates: Letter: N. Section 15 Township: 28 Range: 4 Or Latitude Longitude Pit Type: Dehydrator Location Drip: X Line Drip: Other: Site Assessment Date: 5-15-94 Area: 10 Run: 62					
SITE ASSESSMENT	NMOCD Zone: Cand Type: →BLM					
	TOTAL HAZARD RANKING SCORE: POINTS					
REMARKS	Remarks: ONE PIT ONLOCATION TOCCOSE					
EMA						
22						

(SP3190) 04/08/94


ORIGINAL PIT LOCATION	

REMARKS

ORIGINAL PIT LOCATION

Original Pit: a) Degrees from North 333° Footage from Wellhead 31'

b) Length : <u>24'</u> Width : <u>24'</u> Depth : <u>4</u>

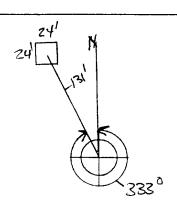

Remarks:

PHOTOGRAPHS AH-G(1-4)

ROAD TO LOCATION BETWEEN COMPRESSOR PLANT AND TANKS

Completed By:

Signature

5-15-93

Date

FIEL PIT REMEDIATION/CLOSU. _ FORM

GENERAL	Meter: 90 200 Location: VALENCIA CANGON Unit *25 Coordinates: Letter: N Section 15 Township: 28 Range: 4 Or Latitude Longitude Date Started: 7-8-94 Area: 10 Run: 62					
FIELD OBSERVATIONS	Sample Number(s): MK/05 Sample Depth: 8 Feet Final PID Reading 184 PID Reading Depth Feet Yes No Groundwater Encountered (1) (2) Approximate Depth Feet					
CLOSTIRE	Remediation Method: Excavation					
Sydvitao	Remarks: <u>EPNG LINES Marked</u> Soil Brownish Gray Strong 174 Drocerbon adar 11st Sand Stone 8' Signature of Specialist: <u>Margan Killion</u>					



FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

_	Field	ID	<u> </u>	Lab ID			
SAMPLE NUMBER:	MK 10	5	945	5621			
MTR CODE SITE NAME:	90200		N/A				
SAMPLE DATE : TIME (Hrs):	8-91		1121				
SAMPLED BY:			I/A	, , , , , , , , , , , , , , , , , , ,			
DATE OF TPH EXT. ANAL.:	7/12/	94	7/1	2/94			
DATE OF BTEX EXT. ANAL.:	NIA		NA				
TYPE DESCRIPTION:	VG		Brown Ce	ruse Son	1 tcha		
RESULTS							
							
PARAMETER	RESULT	UNITS	UNITS QUALIFIERS		ERS		
			DF	Q	M(g)	V(ml)	
BENZENE		MG/KG					
TOLUENE		MG/KG					
ETHYL BENZENE		MG/KG					
TOTAL XYLENES		MG/KG					
TOTAL BTEX		MG/KG					
TPH (418.1)	1250	MG/KG			2,14	28	
HEADSPACE PID	184	PPM			<u> </u>		
PERCENT SOLIDS	87,5	%			<u> </u>		
- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 -							

The Surrogate Recovery was at	NA	_ % for this sample	All QA/QC was acceptable).
Varrative:				
	<u> </u>			

)F = Dilution Factor Used

Valan

Test Method for Oil and Grease and Petroleum Hydrocarbons in Water and Soil Perkin-Elmer Model 1600 FT-IR Analysis Report ***************** 94/07/12 09:28 Sample identification 745621 Initial mass of sample, g Volume of sample after extraction, ml 08.000 Patroleum hydrocarbors, ppm Vet Rosorbance of hydrocarbons (2930 cm-1) .169

