


District I
P.O. Box 1980, Hobbs, NM
District II
P.O. Drawer DD, Artesia, NM 88211
District III
1000 Rio Brazos Rd, Aztec, NM 87410

State of New Mexico
Energy, Minerals and Natural Resources Department

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

OK
SUBMIT 1 COPY TO
APPROPRIATE
DISTRICT OFFICE
AND 1 COPY TO
SANTA FE OFFICE

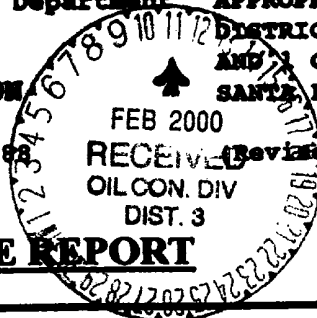

(Revised 3/9/94)

PIT REMEDIATION AND CLOSURE REPORT

Operator: CONDOL INC. Telephone: 505-324-5813

Address: 3315 Bloomfield HWY. FARMINGTON N.M. 87401

Facility Or: SAN JUAN 28-7 #195E
Well Name

Location: Unit or qtr/qtr sec A Sec 16 T 28N R 07W County SAN JUAN

Pit Type: Separator Dehydrator ☒ other

Land Type: BLM ☒, State , Fee , other

Pit Location: Pit dimensions: length 6', width 6', depth 2'

(Attach diagram)

Reference: wellhead ☒, other

Footage from reference: 78'

Direction from reference: 60° Degrees ☒ East North
of
 West South

Depth To Ground Water: Less than 50 feet (20 points)
(Vertical distance from 50 feet to 99 feet (10 points)
contaminants to seasonal Greater than 100 feet (0 points) 0
high water elevation of
ground water)

Wellhead Protection Area: Yes (20 points)
(Less than 200 feet from a private No (0 points) 0
domestic water source, or; less than
1000 feet from all other water sources)

Distance To Surface Water: Less than 200 feet (20 points)
(Horizontal distance to perennial 200 feet to 1000 feet (10 points)
lakes, ponds, rivers, streams, creeks, Greater than 1000 feet (0 points) 0
irrigation canals and ditches)

RANKING SCORE (TOTAL POINTS): 0

Date Remediation Started: 9-24-99

Date Completed: 9-30-99

Remediation Method: Excavation _____
(Check all appropriate sections) Landfarmed _____
Other _____

Approx. cubic yards _____
Insitu Bioremediation _____

Remediation Location: Onsite _____ offsite _____
(ie. landfarmed onsite,
name and location of
offsite facility)

General Description Of Remedial Action: SAMPLE TAKEN, Till Bottom of Pit 1' IN,
BACK Fill with clean SOIL. Hit Bed Rock 2' IN

Ground Water Encountered: No ☒ Yes _____ Depth _____

Final Pit:

Closure Sampling:

(if multiple samples,
attach sample results
and diagram of sample
locations and depths)

Sample location CENTER OF PIT.

Sample depth 4'

Sample date 9-28-99 Sample time 1449

Sample Results

Benzene (ppm) 163

Total BTEX (ppm) 7.030

Field headspace (ppm) 212

TPH 2290

Ground Water Sample: Yes _____ No _____ (If yes, attach sample results)

I HEREBY CERTIFY THAT THE INFORMATION ABOVE IS TRUE AND COMPLETE TO THE BEST
OF MY KNOWLEDGE AND BELIEF

DATE 12-1-99

SIGNATURE

Judson Valdez

PRINTED NAME
AND TITLE

Judson Valdez P.L.

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8015 Modified Nonhalogenated Volatile Organics Total Petroleum Hydrocarbons


Client:	Conoco	Project #:	707003-104
Sample ID:	SEP - Grab	Date Reported:	10-02-99
Laboratory Number:	G146	Date Sampled:	09-28-99
Chain of Custody No:	7389	Date Received:	10-01-99
Sample Matrix:	Soil	Date Extracted:	10-01-99
Preservative:	Cool	Date Analyzed:	10-02-99
Condition:	Cool and Intact	Analysis Requested:	8015 TPH

Parameter	Concentration (mg/Kg)	Det. Limit (mg/Kg)
Gasoline Range (C5 - C10)	1,860	0.2
Diesel Range (C10 - C28)	431	0.1
Total Petroleum Hydrocarbons	2,290	0.2

ND - Parameter not detected at the stated detection limit.

References: Method 8015B, Nonhalogenated Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan #195 E OVM Reading 212. Rock Bed 2' In.

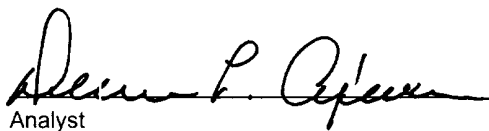
Analyst


Review

ENVIROTECH LABS

PRACTICAL SOLUTIONS FOR A BETTER TOMORROW

EPA METHOD 8021 AROMATIC VOLATILE ORGANICS

Client:	Conoco	Project #:	707003-104
Sample ID:	SEP - Grab	Date Reported:	10-02-99
Laboratory Number:	G146	Date Sampled:	09-28-99
Chain of Custody:	7389	Date Received:	10-01-99
Sample Matrix:	Soil	Date Analyzed:	10-02-99
Preservative:	Cool	Date Extracted:	10-01-99
Condition:	Cool & Intact	Analysis Requested:	BTEX

Parameter	Concentration (ug/Kg)	Det. Limit (ug/Kg)
Benzene	163	8.8
Toluene	110	8.4
Ethylbenzene	235	7.6
p,m-Xylene	5,100	10.8
o-Xylene	1,420	5.2
Total BTEX	7,030	


ND - Parameter not detected at the stated detection limit.

Surrogate Recoveries:	Parameter	Percent Recovery
	Trifluorotoluene	100 %
	Bromofluorobenzene	100 %

References: Method 5030B, Purge-and-Trap, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Method 8021B, Aromatic Volatile Organics, Test Methods for Evaluating Solid Waste, SW-846, USEPA, December 1996.

Comments: San Juan 28 - 7 #195 E OVM Reading 212. Rock Bed 2' In.

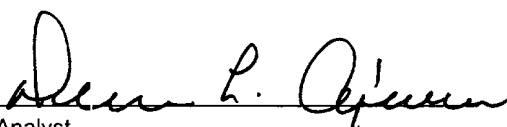
Analyst


Review

7389

ENVIROTECH INC.

5796 U.S. Highway 64
Farmington, New Mexico 87401
(505) 632-0615

Lease Name: San Juan 28-7 #195E

Operator: SM



Date: 3/31/98

Site Security
(Indicate North)

Vent
Pit
BDP
6'X6'X2'
100'FWH
14°N
ABANDON


H2O
Pit

DEP
78'FWH
60°E
6'X6'X2'
ABANDON

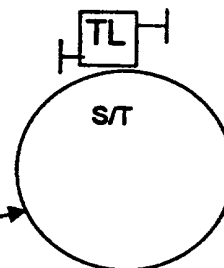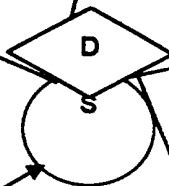


Drain
Pit

TDP
93'FWH
110°E
6'X6'X2'



GM



Lease Name: San Juan 28-7 #195E

Federal/ Indian Lease No: SF 078497

CA No.: 082078417A

Unit: A

Legal Description: Sect: 16 TP: 28N R: 7W

County: Rio Arriba, NM

Load line valves :
Sealed during Production

Drain line valves :
Sealed during Production

Production Line valves:
Sealed during sales

This lease is subject to the site security plan for
San Juan Basin Operations. The plan is located at:
Conoco Inc.
3315 Bloomfield Hwy
Farmington, NM