

(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 078898  
Unit Sullivan

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	<u>Sandoil Fracture</u>	<input checked="" type="checkbox"/>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

February 19, 1957


Well No. 1-F is located 1090 ft. from WEST line and 1575 ft. from WEST line of sec. 32  
SW Section 32 27N 12W 10E  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Wilcox San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 5887 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

2-15-57 Total Depth 5065'. Plug back T.D. 5061'.  
 Sandoil fractured Gallup perforated intervals 4950-4960, 4964-4981, 4990-5025  
 with 42,500 gallons water and 40,000# sand. Breakdown pressure 3000#, maximum  
 pressure 3150#, average treating pressure 1675#. Injection rate 60 1/2 BPM.  
 Flush 2,500 gallons.

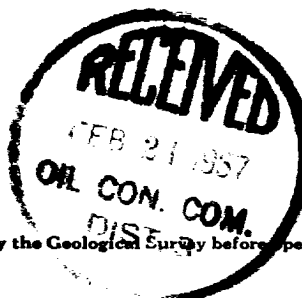

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company  
 Address Box 997  
Farmington, New Mexico

By Original Signed EWELL N. WALSH  
 Title Petroleum Engineer