

T-27-W  
R-9-W  
Sec. 34

(SUBMIT IN TRIPPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe, N.M.  
Lease No. SW 080117  
Unit Huerfano Unit I  
Section 943

## SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ALIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	<b>Subsequent Report of Casing Setting X</b>

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 3, 1963


Well No. 2-34 is located 1850 ft. from N line and 1500 ft. from E line of sec. 34  
NE/4 Section 34 T-27-W R-9-W BNM  
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)  
Basin-Dakota San Juan New Mexico  
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is \_\_\_\_\_ ft.

### DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

3-31-63 Total Depth drilled 6,922'. Ran 316 joints of 4 1/2" J-55 9.5# & 10.5# casing set at 6,915' w/DV tools at 4,936' and 2,412'. Cemented bottom with 300 sacks common cement with 2% CaCl. Plug down at 12:10 a.m. Cement 4,946' w/72 sacks Dia-Mix A cement. Plug down at 5:15 a.m. Cemented at 2,412' with 245 sacks Dia-Mix A 50-50 cement. Plug down at 8:50 a.m. Good returns on all cementing.  
4-1-63 - Waiting on cement 24 hours. Tested BOP's and casing to 1500#. Made up 2-3/8" work string and drilled DV tool at 2,412'. Tested to 1,500#. Drilled DV tool at 4,946'. Tested to 1,500#. Held o.k.

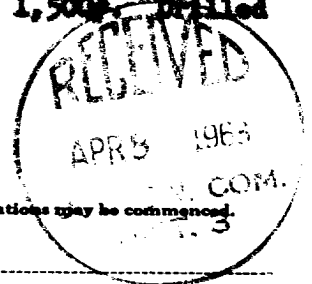

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company Austral Oil Company Incorporated

Address 300 San Jacinto Building

Houston 2, Texas

By R. Copeland

Title Drilling Superintendent