


(SUBMIT IN TRIPLICATE)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
GEOLOGICAL SURVEY

Land Office Santa Fe  
Lease No. 07232  
Unit Bolack

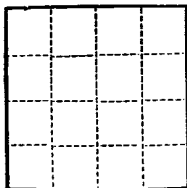

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL		SUBSEQUENT REPORT OF WATER SHUT-OFF	X
NOTICE OF INTENTION TO CHANGE PLANS		SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF		SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL		SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE		SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING		SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL			

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

June 2, 1958

Well No. 16-C (2M) is located 210 ft. from N line and 220 ft. from E line of sec. 33

NE Sec. 33 (1/4 Sec. and Sec. No.) 27N (Twp.) 1W (Range) N.M.P.M. (Meridian)  
Blanco M. V. Ext-30. Blanco P.C. Ext. (Field) San Juan (County or Subdivision) New Mexico (State or Territory)

The elevation of the derrick floor above sea level is 6751 ft.


DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On 5-10-58, Total Depth 2919'.  
Ran 69 joints 7 5/8", J-35, 26.40#, casing (2906') set at 2918' with 100 sacks regular cement, 100 sacks Pozmix, 50# Floccle and 4# Gel, followed with 50 sacks Best cement, w/2% CaCl.

Held 1000#/30 minutes.

Top of cement by temperature survey at 1750'.

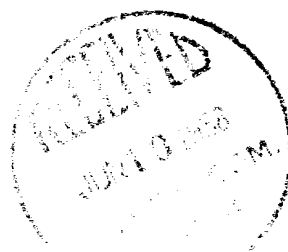

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company  
Address Box 997  
Farmington, New Mexico  
By Original Signed D. C. Johnson  
Title Petroleum Engineer



1000 1000 1000 1000

--	--	--	--