


(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 080117
Unit SE/4

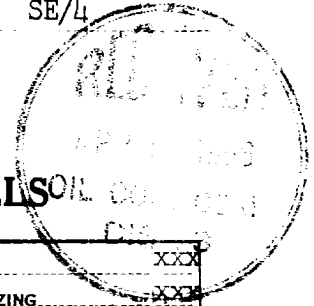

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

March 19, 1956. 19

Huerfano Unit
Well No. 40-27 is located 1585 ft. from N line and 945 ft. from E line of sec. 27
SE/4 Sec. 27 T 27-N R 9-W N.M.P.M.
($\frac{1}{4}$ Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Fulcher Kutz Ext. San Juan County New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6399 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

February 9, 1956. After drilling to 2252' (Top of Pictured Cliffs 2246') set 15 joints 5-1/2" OD 15.5# casing (J-55), and 56 joints 5-1/2" OD 14# J-55 casing at 2246' with 100 sacks cement. Moved off.

March 15, 1956 - Rigged up cable tools. Three hour test showed no water.

March 17, 1956. Sand oil treated from 2246' to 2270' with 14,100 gallons diesel oil and 15,000# sand. Flushed with 2,300 gallons diesel. Used 15 gallons Hi-flo. Breakdown 1300#. Injection 39.1 barrels per minute.

March 18, 1956. Ran 102 joints (2252') of 1" tubing - landed at 2259'. Shut well in for potential test; and to await pipe line connection.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company J. Glenn Turner
Address Box 728
Farmington, New Mexico.

By [Signature]
C. Beeson Neal, Agent in Farmington
Title _____