

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office **Santa Fe**

Lease No. **SM - 08349**

Unit **1/2** Sec. **34**

SUNDRY NOTICES AND REPORTS ON WELLS

RECEIVED

NOTICE OF INTENTION TO DRILL.....	SUBSEQUENT REPORT OF WATER SHUT-OFF.....
NOTICE OF INTENTION TO CHANGE PLANS.....	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING.....
NOTICE OF INTENTION TO TEST WATER SHUT-OFF.....	SUBSEQUENT REPORT OF ALTERING CASING.....
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL.....	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR.....
NOTICE OF INTENTION TO SHOOT OR ACIDIZE.....	SUBSEQUENT REPORT OF ABANDONMENT.....
NOTICE OF INTENTION TO PULL OR ALTER CASING.....	SUPPLEMENTARY WELL HISTORY.....
NOTICE OF INTENTION TO ABANDON WELL.....	Subsequent Report of Well
	Abandonment

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

September 12, 1960


Delhi-Florence
Well No. **2-2** is located **1450** ft. from **N** line and **1170** ft. from **W** line of sec. **30**
34/4 Sec. **35** **24-N** **23** **106PM**
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Unders. Dakota **San Juan** **New Mexico**
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is **5572** ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

After 5-1/2" casing was run and cement set, casing was tested to 3500# and held. Perforated 6686-6714, 6686-67, 6650-58, 6626-34, 6610-16 w/4 jets per ft. Free w/85,000 gals water, 2,000 gals flush, 60,000# sand pressures 2300-3200 IR 46.4 BPM. Set plug at 6600. Perforated 6326-86 w/4 jets per ft. Free w/60,000 gals water, 2,000 gals flush, 60,000# sand pressures 2100-2300# IR 50 BPM. Drilled plug CD to 6753. Landed 2" tubing at 6600, set inner tree. SI and blowing to clean up old test.

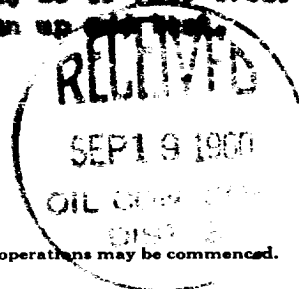

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company **Delhi-Taylor Oil Corporation**

Address **P. O. Drawer 1198**

Farmington, New Mexico

By **J. S. Maxwell**
Title **District Superintendent**