


(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

Land Office Santa Fe
Lease No. 77056-4
Unit Howell

SUNDRY NOTICES AND REPORTS ON WELLS

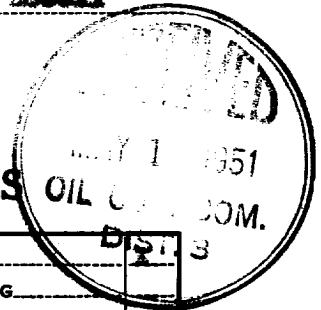

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF REDRILLING OR REPAIR
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY
NOTICE OF INTENTION TO ABANDON WELL	

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

April 30, 19 51

Well No. 4 is located 1320 ft. from [S] line and 1090 ft. from [W] line of sec. 27

Sec. 27 23N 3E T. 23N. R. 3E.
(1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
Largo Ext. San Juan New Mexico
(Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6273 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

On April 20, 1951:

Run 7" casing using 22 joints of J-40 - 23 lb. (664') on bottom, and 105 joints of 20 lb. new s.s. J-55 on top (3576') set at 4255'. Cemented in two stages.

First stage used 150 sacks Ideal Regular Cement and 1 sack Floccal. Top of cement by Temperature Survey 3660'.

Second Stage used 250 sacks Ideal Regular Cement and 3 sacks Floccal. Top of cement by Temperature Survey 1600'.

Held 1000 pounds for 9 hours OK.

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company SAN JUAN PRODUCTION COMPANY

Address 1024 North Court Avenue

Farmington, New Mexico

By E. J. Coal
E. J. Coal

Title Petroleum Engineer

(SUBMIT IN TRIPLICATE)
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO ABANDON WELL
NOTICE OF INTENTION TO REPAIR WELL
NOTICE OF INTENTION TO TEST WATER SHOW
NOTICE OF INTENTION TO CHANGE PLANT
SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING
SUBSEQUENT REPORT OF ALTERING CASING
SUBSEQUENT REPORT OF REPAIRING OR REPAIRING
SUBSEQUENT REPORT OF ABANDONMENT
SUBSEQUENTARY WELL IN THE SAME AREA

INDICATE ABOVE BY CHECK MARK NATURE OF REPORT: NOTICE OR OF REPORT DATA

Well No. _____ is located _____ ft from _____ line and _____ ft from _____ line of section _____

County of _____ State of _____
Date of report _____

The elevation of the bench mark above sea level is _____ ft.

DETAILS OF WORK

In this report are described the work done, the results obtained, and the conclusions reached. The work was done under the direction of _____ and the assistance of _____.

Approved: _____

Special Agent in Charge

Geological Survey

Department of the Interior

Washington, D.C. 20548