
Denny S. Fourt
DEPUTY OIL & GAS INSPECTOR

DEC 2 9 1997

Approved

Meter Number:73819
Location Name:STATE COM A #2
Location:TN-28 RG-09
SC-16 UL-N
1 - State
NMOCD Zone:OUTSIDE
Hazard Ranking Score:00

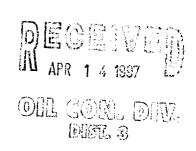

#### RATIONALE FOR RISK-BASED CLOSURE OF PRODUCTION PITS LOCATED OUTSIDE OF THE VULNERABLE ZONE IN THE SAN JUAN BASIN

This production pit location was ranked according to the criteria in the New Mexico Oil Conservation Division's Unlined Surface Impoundment Closure Guidelines and received a ranking score of zero. The estimated depth to groundwater is greater than 100-feet beneath ground surface (bgs), the pit is not in a well head protection area, and there are no surface water bodies within 1,000 horizontal feet of the pit location.

The primary source, discharge to the pit has been removed. There has been no discharge to the pits for at least 4 years and the pits have been closed for at least one year.

Each pit was backfilled with clean soil and graded in a manner to divert precipitation away from the excavated area. Minimal infiltration of rainfall is expected. Any rainfall that does infiltrate the ground surface must migrate through clean backfill before reaching the residual hydrocarbons.

There is no source material at the ground surface, so direct contact of hydrocarbons with livestock and the populous is not likely.

In general, outside of the vulnerable area and alluvial valleys, bedrock material is generally encountered within 20 feet of the ground surface. Bedrock material in the San Juan Basin consists of interbedded sandstones, shales and clays. According to Freeze and Cherry, 1979, the hydraulic conductivity of the bedrock material are as follows:

Sandstone  $10^{-9}$  to  $10^{-13}$  cm/sec Shale  $10^{-12}$  to  $10^{-16}$  cm/sec Clay  $10^{-12}$  to  $10^{-15}$  cm/sec

Based on this information, the residual hydrocarbons should not migrate to groundwater.

Natural process (bioremediation) are degrading the residual hydrocarbon to carbon dioxide and water and will continue until the source is gone, therefore minimizing any impact to the environment.

Based on the above information, it is highly unlikely that any source material will impact groundwater or ever find an exposure pathway to affect human health and therefore El Paso Field Services Company (EPFS) requests closure of this pit location.



## FIELD PIT SITE ASSESSMENT FORM

GENERAL	Meter: 73819 Location: STATE COM A #2  Operator #: 0128 Operator Name: MERIDIAN P/L District: BLANCO  Coordinates: Letter: N Section 16 Township: 28 Range: 9  Or Latitude Longitude  Pit Type: Dehydrator Location Drip: X Line Drip: Other:  Site Assessment Date: 5:15:94
<u></u>	NMOCD Zone:  (From NMOCD  Maps)  Inside  Outside  Outside  Depth to Groundwater  Less Than 50 Feet (20 points)  50 Ft to 99 Ft (10 points)  Greater Than 100 Ft (0 points)  Wellhead Protection Area:
SITE ASSESSMENT	Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction?, or ; is it less than 200 ft from a private domestic water source? (1) YES (20 points) (2) NO (0 points)  Horizontal Distance to Surface Water Body  Less Than 200 Ft (20 points) (1)  200 Ft to 1000 Ft (10 points) (2)  Greater Than 1000 Ft (0 points) (3)  Name of Surface Water Body  (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds)  Distance to Nearest Ephemeral Stream (1) < 100'(Navajo Pits Only)  (2) > 100'  TOTAL HAZARD RANKING SCORE: OPOINTS
REMARKS	Remarks: Two PITS ON LOCATION, WILL CLOSE ONLY ONE, PIT IS DRY. LOCATION IS UP ON TOP OF LITTLE HARRIS MESA, REDLINE AND TOPO
REN	CONFIRMED LOCATION IS OUTSIDE U.Z. PUSH IN

7	ORIGINAL PIT LOCATION  Original Pit: a) Degrees from North 169° Footage from Wellhead 39'  b) Length: 14' Width: 13' Depth:/'
ORIGINAL PIT LOCATION	od of the state of
REMARKS	Remarks: TOOK PICTURES AT 10:31 A.M. DUMP TRUCK - BORTAIL
	Completed By:  Signature  Completed By:  5.15.94  Date

# FIELD PIT REMEDIATION/CLOSURE FORM

GENERAL	Meter: 73819 Location: State Com A # 2  Coordinates: Letter: N Section 16 Township: 28 Range: 9  Or Latitude Longitude Date Started: 7-21-94 Run: 63 31
FIELD OBSERVATIONS	Sample Number(s): MK 175  Sample Depth: Feet  Final PID Reading PID Reading Depth Feet  Yes No  Groundwater Encountered
CLOSURE	Remediation Method:  Excavation  Onsite Bioremediation  Backfill Pit Without Excavation  Soil Disposition:  Envirotech  Other Facility  Name:  Pit Closure Date: 7-21-941  Pit Closed By: BET
REMARKS	Remarks: EPNG lines Not Marked Soil light Brown Strong HyDrocarbon odor  Signature of Specialist: Morgan Kielion



# ANALYTICAL REPORT

### PIT CLOSURE PROJECT - Soil

### SAMPLE IDENTIFICATION

_	Field	I ID	·	Lab ID		
SAMPLE NUMBER:	MK 175 73819 7,21,94		945741 N/A			
MTF CODE   SITE NAME:						
SAMPLE DATE   TIME (Hrs):						
SAMPLED BY:	N/A					
ATE OF TPH EXT. ANAL.:	7-26-94 NA VG		7-26-94 NA			
TE OF BTEX EXT.   ANAL.:						
TYPE   DESCRIPTION:			Fire 3	3auc		
REMARKS:						
		RESULTS	<del></del>			
PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml
BENZENE		MG/KG	10 000			
TOLUENE		MG/KG	·			, <del></del>
ETHYL BENZENE		MG/KG				
TOTAL XYLENES		MG/KG				
TOTAL BTEX		MG/KG				
TPH (418.1)	2270	MG/KG			2.19	28
HEADSPACE PID	// O	PPM				·
PERCENT SOLIDS	90.1	%				
Surrogate Recovery was at	- TPH is by EPA Method 4	18.1 and BTEX is by EPA		was accep	otable.	

RIRIGII

F = Dilution Factor Used

n P

\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\*\* Test Method for

Oil and Grease and Petroleum Hydrocarbons
in Water and Soil

24/07/26 11:13

Sample identification \*45741

Initial mass of sample, **g** NIPO

Volume of sample after extraction, ml 35.000

Retroleum hydrocarbons opm 1774:164 | Ment Absorbance of hydrocartone (1777) ca-11 | 717



