

Santa Fe

Land Office

679232


Lease No.

Bolack

Unit

(SUBMIT IN TRIPLICATE)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

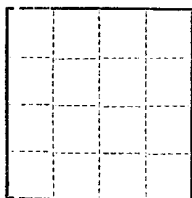

SUNDRY NOTICES AND REPORTS ON WELLS

NOTICE OF INTENTION TO DRILL	SUBSEQUENT REPORT OF WATER SHUT-OFF	
NOTICE OF INTENTION TO CHANGE PLANS	SUBSEQUENT REPORT OF SHOOTING OR ACIDIZING	
NOTICE OF INTENTION TO TEST WATER SHUT-OFF	SUBSEQUENT REPORT OF ALTERING CASING	
NOTICE OF INTENTION TO RE-DRILL OR REPAIR WELL	SUBSEQUENT REPORT OF RE-DRILLING OR REPAIR	
NOTICE OF INTENTION TO SHOOT OR ACIDIZE	SUBSEQUENT REPORT OF ABANDONMENT	
NOTICE OF INTENTION TO PULL OR ALTER CASING	SUPPLEMENTARY WELL HISTORY	
NOTICE OF INTENTION TO ABANDON WELL	Water Fracture	X

(INDICATE ABOVE BY CHECK MARK NATURE OF REPORT, NOTICE, OR OTHER DATA)

October 22, 1956


Well No. 4-C is located 1636 ft. from N line and 800 ft. from E line of sec. 20
Section 29 27N 6W 10E2
 (1/4 Sec. and Sec. No.) (Twp.) (Range) (Meridian)
San Blanco P.C. Ran Juan New Mexico
 (Field) (County or Subdivision) (State or Territory)

The elevation of the derrick floor above sea level is 6309 ft.

DETAILS OF WORK

(State names of and expected depths to objective sands; show sizes, weights, and lengths of proposed casings; indicate mudding jobs, cementing points, and all other important proposed work)

October 21, 1956 Total Depth 2409'. Plug back T.D. 2355'.
 Water fractured Pictured Cliff perforated intervals 2315-2328 with 38,850
 gallons water and 40,000# sand. Breakdown pressure 2600#, maximum
 pressure 1400#, average treating pressure 1100#. Injection rate 43.3 BPM.
 Flush 3360 gallons.

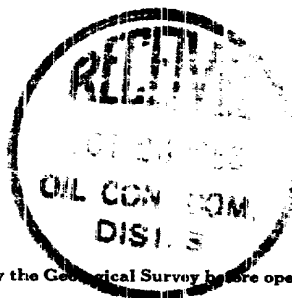

I understand that this plan of work must receive approval in writing by the Geological Survey before operations may be commenced.

Company El Paso Natural Gas Company

Address Box 997

Farmington, New Mexico

By

W. M. Walsh

Title

Petroleum Engineer

