

FIELD PIT SITE ASSESSMENT FORM


EPFS
EL PASO FIELD SERVICES

GENERAL	Meter: <u>87704</u> Location: <u>RIDDLE ^G #2</u> Operator #: <u>2999</u> Operator Name: <u>MERIDIAN</u> P/L District: <u>BLANCO</u> Coordinates: Letter: <u>B</u> Section <u>7</u> Township: <u>28</u> Range: <u>8</u> Or Latitude _____ Longitude _____ Pit Type: Dehydrator ☒ Location Drip: _____ Line Drip: _____ Other: _____ Site Assessment Date: <u>5.14.94</u> Area: <u>13</u> Run: <u>22</u>
SITE ASSESSMENT	NMOCD Zone: (From NMCCD Maps) Inside ☒ (1) Outside ☐ (2) Land Type: BLM ☒ (1) State ☐ (2) <i>Per Fee: 17.37</i> DEPUTY CHIEF OF GAS INSPECTOR SEP 10 1996 Depth to Groundwater Less Than 50 Feet (20 points) ☒ (1) 50 Ft to 99 Ft (10 points) ☐ (2) Greater Than 100 Ft (0 points) ☐ (3) Wellhead Protection Area : Is it less than 1000 ft from wells, springs, or other sources of fresh water extraction? , or ; Is it less than 200 ft from a private domestic water source? ☐ (1) YES (20 points) ☒ (2) NO (0 points) Horizontal Distance to Surface Water Body Less Than 200 Ft (20 points) ☐ (1) 200 Ft to 1000 Ft (10 points) ☒ (2) Greater Than 1000 Ft (0 points) ☐ (3) Name of Surface Water Body <u>CUTTER CANYON</u> (Surface Water Body : Perennial Rivers, Major Wash, Streams, Creeks, Irrigation Canals, Ditches, Lakes, Ponds) Distance to Nearest Ephemeral Stream ☐ (1) < 100' (Navajo Pits Only) ☐ (2) > 100' TOTAL HAZARD RANKING SCORE: <u>30</u> POINTS
REMARKS	Remarks : <u>ONLY PIT ON LOCATION. PIT IS DRY. LOCATION IS ON A LITTLE HILL IN CUTTER CANYON. REDLINE AND TOPO CONFIRMED LOCATION TO BE INSIDE V.2.</u> DIG & HAUL

ORIGINAL PIT LOCATION

Original Pit : a) Degrees from North 326° Footage from Wellhead 14'
b) Length : 17' Width : 16' Depth : 4'

ORIGINAL PIT LOCATION

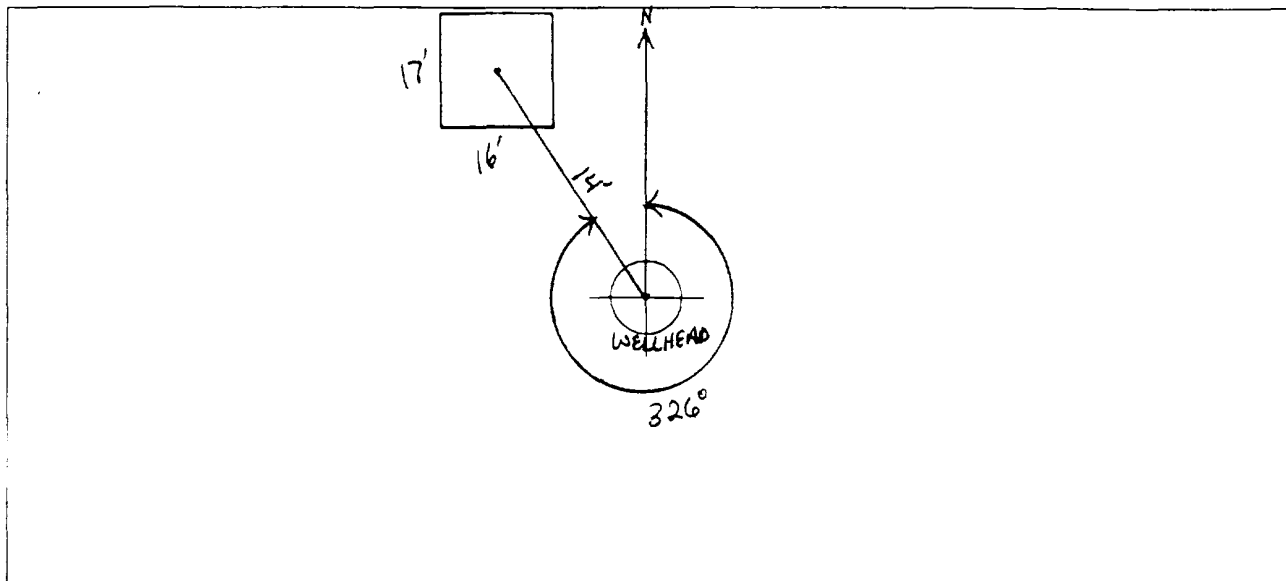

REMARKS

Remarks :

TOOK PICTURES AT 8:35 A.M.

END DUMP

Completed By:

Robert Thompson
Signature

5.14.94
Date

GENERAL

Meter: 87704 Location: Riddle G #2Coordinates: Letter: B Section 7 Township: 28 Range: 8

Or Latitude _____ Longitude _____

Date Started : 5-31-94 Area: 13 Run: 22

FIELD OBSERVATIONS

Sample Number(s): KD87 KD88 KD89Sample Depth: 12 FeetFinal PID Reading 1 ppm PID Reading Depth 12' Feet

Yes No

Groundwater Encountered ☐ (1) ☒ (2) Approximate Depth _____ Feet

CLOSURE

Remediation Method :

Excavation ☐ (1) Approx. Cubic Yards 0Onsite Bioremediation ☐ (2)Backfill Pit Without Excavation ☒ (3)

Soil Disposition:

Envirotech ☐ (1) ☒ (3) TierraOther Facility ☐ (2) Name: _____Pit Closure Date: 5-31-94 Pit Closed By: BET

REMARKS

Remarks : Test Hole revealed no Contamination, TOOK PID
Sample at 12' - 1ppm. Closed p.r.Signature of Specialist: Kenny Damm

FIELD SERVICES LABORATORY ANALYTICAL REPORT PIT CLOSURE PROJECT - Soil

SAMPLE IDENTIFICATION

SAMPLE NUMBER:

Field ID

Lab ID

MTR CODE | SITE NAME:

SAMPLE DATE | TIME (Hrs):

SAMPLED BY:

DATE OF TPH EXT. ANAL:

DATE OF BTEX EXT. ANAL:

TYPE | DESCRIPTION:

KD87

945298

87704

N/A

5/31/94

1030

N/A

6/2/94

6/2/94

6/15/94

6/15/94

UG

Brown Sand + Clay

REMARKS:

RESULTS

PARAMETER	RESULT	UNITS	QUALIFIERS			
			DF	Q	M(g)	V(ml)
BENZENE	<0.025	MG/KG	1			
TOLUENE	<0.025	MG/KG	1			
ETHYL BENZENE	<0.025	MG/KG	1			
TOTAL XYLENES	<0.025	MG/KG	1			
TOTAL BTEX	<0.10	MG/KG				
TPH (418.1)	<10	MG/KG			2.00	28
HEADSPACE PID	1	PPM				
PERCENT SOLIDS	92.9	%				

- TPH is by EPA Method 418.1 and BTEX is by EPA Method 8020 -

The Surrogate Recovery was at
narrative:

100

% for this sample

All QA/QC was acceptable.

ATT results attached.

DF = Dilution Factor Used

Approved By:

John F. Sandoz

Date:

7/14/94



Analytical **Technologies**, Inc.

2709-D Pan American Freeway NE Albuquerque, NM 87107
Phone (505) 344-3777 FAX (505) 344-4413

ATI I.D. 406313



June 10, 1994

El Paso Natural Gas
P.O. Box 4990
Farmington, NM 87499

Project Name/Number: PIT CLOSURE 24324

Attention: John Lambdin

On 06/03/94, Analytical Technologies, Inc., (ADHS License No. AZ0015), received a request to analyze **non-aqueous** samples. The samples were analyzed with EPA methodology or equivalent methods. The results of these analyses and the quality control data, which follow each set of analyses, are enclosed.

If you have any questions or comments, please do not hesitate to contact us at (505) 344-3777.


H. Mitchell Rubenstein, Ph.D.
Laboratory Manager

MR:jd

Enclosure

GAS CHROMATOGRAPHY RESULTS

TEST : BIEX (EPA 8020)
 CLIENT : EL PASO NATURAL GAS ATI I.D.: 406313
 PROJECT # : 24324
 PROJECT NAME : PIT CLOSURE

SAMPLE ID. #	CLIENT I.D.	MATRIX	DATE SAMPLED	DATE EXTRACTED	DATE ANALYZED	DIL. FACTOR
01	945297	NON-AQ	05/31/94	06/06/94	06/06/94	1
02	945298	NON-AQ	05/31/94	06/06/94	06/06/94	1
03	945300	NON-AQ	05/31/94	06/06/94	06/06/94	1
PARAMETER			UNITS	01	02	03
BENZENE			MG/KG	<0.025	<0.025	<0.025
TOLUENE			MG/KG	<0.025	<0.025	<0.025
ETHYLBENZENE			MG/KG	<0.025	<0.025	<0.025
TOTAL XYLENES			MG/KG	0.10	<0.025	<0.025

SURROGATE:

BROMOFLUOROBENZENE (%) 109 106 103